ENCON International, Inc.
Engineering, Environmental, & Technical Services

June 23, 2008

Mr. Henry Wilson
Asbestos & Lead Manager
DPW, Bldg. 777
Fort Bliss, TX 79916

Phone: (915) 568-2300
Fax: (915) 568-4304

RE: SUBMITTAL OF ASBESTOS & LEAD SURVEY REPORTS
Ft. Bliss Bldg. # 2447
ENCON Project #103-08-094

Dear Mr. Wilson,

This document summarizes the Asbestos & Lead Survey Report for the subject facility. The below-listed information was utilized to complete the Scope of Work Tasks:

Project Location and/or Room No. Whole Bldg.

Brief SOW:
Performed sampling prior to demolition or renovation activities.

ASBESTOS – The sample collection and subsequent laboratory analytical results indicated that asbestos was not identified in the sampled building materials.

LEAD – Results indicate that twenty-six (26) of the one hundred fifty-two (152) XRF readings tested at or above the limit of 0.3 mg/cm^2

Technical Summary	Were Found	Were Not Found	Not Tested
1. Asbestos Containing Materials **(>1 %)**		X	
2. Lead Based Paint Materials	X		

Contact me with any technical questions, or follow-up needs that you may have.

Sincerely:

Alex Woelper P.E.
Project Manager

Attachments:

- **Asbestos & Lead Survey Reports**

ASBESTOS SURVEY REPORT
BUILDING 2447
FORT BLISS, TEXAS 79916

Prepared for:
Mr. Henry Wilson, P.E.
DPW
Building 777
Fort Bliss, Texas 79916

Prepared by:
ENCON International, Inc.
7307 Remcon Circle,
Suite 103
El Paso, Texas 79912

Date of Inspection:
June 12, 2008

ENCON Project No. 103-08-094

ENCON INTERNATIONAL, INC.

Engineering, Environmental & Technical Services

June 17, 2008

Mr. Henry Wilson, P.E.
Asbestos & Lead Manager
DPW, Bldg. 777
Fort Bliss, TX 79916

Phone: (915) 568-2300
Via email & hand delivery

RE: ASBESTOS SURVEY REPORT
Building 2447
Fort Bliss, TX 79916

Dear Mr. Wilson,

ENCON International, Inc., (ENCON) has submitted for your review the attached Asbestos Survey Report. This Asbestos Survey was conducted in accordance with Asbestos National Emissions Standards for Hazardous Air Pollutants (NESHAP): 40 CFR Part 61, Subpart M. Sampling protocols were performed in accordance with the Texas Asbestos Health Protection Rules (TAHPR).

This Asbestos Survey was properly performed by ENCON DSHS licensed personnel. ENCON's personnel have been trained and are in compliance with Texas Department of State Health Services (DSHS) regulations. If you have any questions regarding this Asbestos Survey, please feel free to contact us at your convenience.

Sincerely,

Alex Woelper, P.E.
Program Manager

Attachments:

- Asbestos Survey Report
- Asbestos Drawings
- Photo Log
- Laboratory Documentation

ASBESTOS SURVEY REPORT
Ft. Bliss, Bldg. 2447

SUMMARY

ENCON International, Inc. (ENCON) personnel performed an Asbestos Inspection of a structure designated as "Building 2447" on Fort Bliss, Texas. The following are the field sample collection and analysis results for this inspection. The inspection was conducted to ensure compliance with NESHAP – 40 CFR Part 61, Subpart M, which states that "prior to the commencement of the demolition or renovation, thoroughly inspect the affected facility or part of the facility where the demolition or renovation operation(s) will occur for the presence of asbestos, including Category I and Category II non-friable ACM. "

The sample collection and subsequent laboratory analytical results indicated that asbestos was not identified in the sampled building materials.

INTRODUCTION

This Asbestos Survey was performed by Mr. David Morales on June 12th, 2008. This Asbestos Survey was conducted in accordance with Asbestos National Emissions Standards for Hazardous Air Pollutants (NESHAP): 40 CFR Part 61, Subpart M. Sampling protocols were performed in accordance with the Texas Asbestos Health Protection Rules (TAHPR). Building 2447 was to undergo renovations and was visually inspected and it was determined that the suspect asbestos-containing materials could be divided into thirty (30) homogeneous areas, including the following: rubberized flooring mastic (3 types), cove base mastic (9 types), textured drywall/joint compound (8 types), 12" x 12" floor tile & mastic (3 types), carpet mastic (4 types), 2' x 4' ceiling panels (2 types), and textured stucco.

DESCRIPTION

Building 2447 was being used as military personnel housing on Fort Bliss, Texas. The building occupied approximately 38,000 SF. The building was a three-story structure constructed with

CMU walls on a concrete foundation. The interior was partitioned with drywall walls. The floor was covered with floor tile and carpeting. At the time this Asbestos Survey was performed, the date of construction was not known.

SAMPLING METHODOLOGY

A visual inspection of the building was conducted to develop a sampling plan. This included determining sample collection points, homogeneous materials and areas. Friability was assessed by manually manipulating the suspect asbestos materials utilizing hand pressure to determine if the materials, when dry, can be crumbled, pulverized, or reduced to powder. Thirty (30) homogeneous areas were established and at least three (3) samples were collected from each area. Areas that have suspect asbestos-containing surfacing, thermal systems insulation, or miscellaneous materials are to be considered homogeneous. These samples were each uniquely and individually identified and logged into a chain of custody document and prepared for shipment to a third-party independent laboratory for analysis. Building materials that are not considered suspect include the following; concrete, metal, glass, and wood. Destructive sampling was not authorized or performed to locate hidden or inaccessible materials.

SAMPLE ANALYSIS

Ninety (90) samples were submitted for analysis. Bulk PLM analysis was conducted utilizing the EPA Method 600/R-93/116. This method separates the sample material into various layers based on their morphology, and then the presence of the different asbestos fibers in each of these layers is detected. The analysis was performed by Apex Precision Analytical Services, Inc. located in Friendswood, TX. The term asbestos-containing material (ACM) is defined as a material that contains greater than 1% of any asbestiform varieties of Chrysotile, Amosite, Crocidolite, Tremolite, Anthophyllite, and Actinolite, or combinations of these materials. Asbestos materials were determined by the July 1993 Environmental Protection Agency as recommended in document EPA/600/R-93/116 titled, "Method for the Determination of Asbestos in Bulk Building Materials." Copies of the asbestos laboratory results and related documentation have been attached to this Report.

CONCLUSION

No asbestos-containing materials were identified as part of this asbestos survey. No further assessment is recommended at this time. If, during the course of any remodeling or demolition activities suspect materials are found, then additional sampling and analysis may be required.

Contact the Asbestos Inspector listed below with any clarifications that may be needed.

Inspected by:

David Morales
Asbestos Inspector
License # 60-2735

Reviewed by:

Tim Jones
Asbestos Consultant
License # 10-5575

ENCON International, Inc.

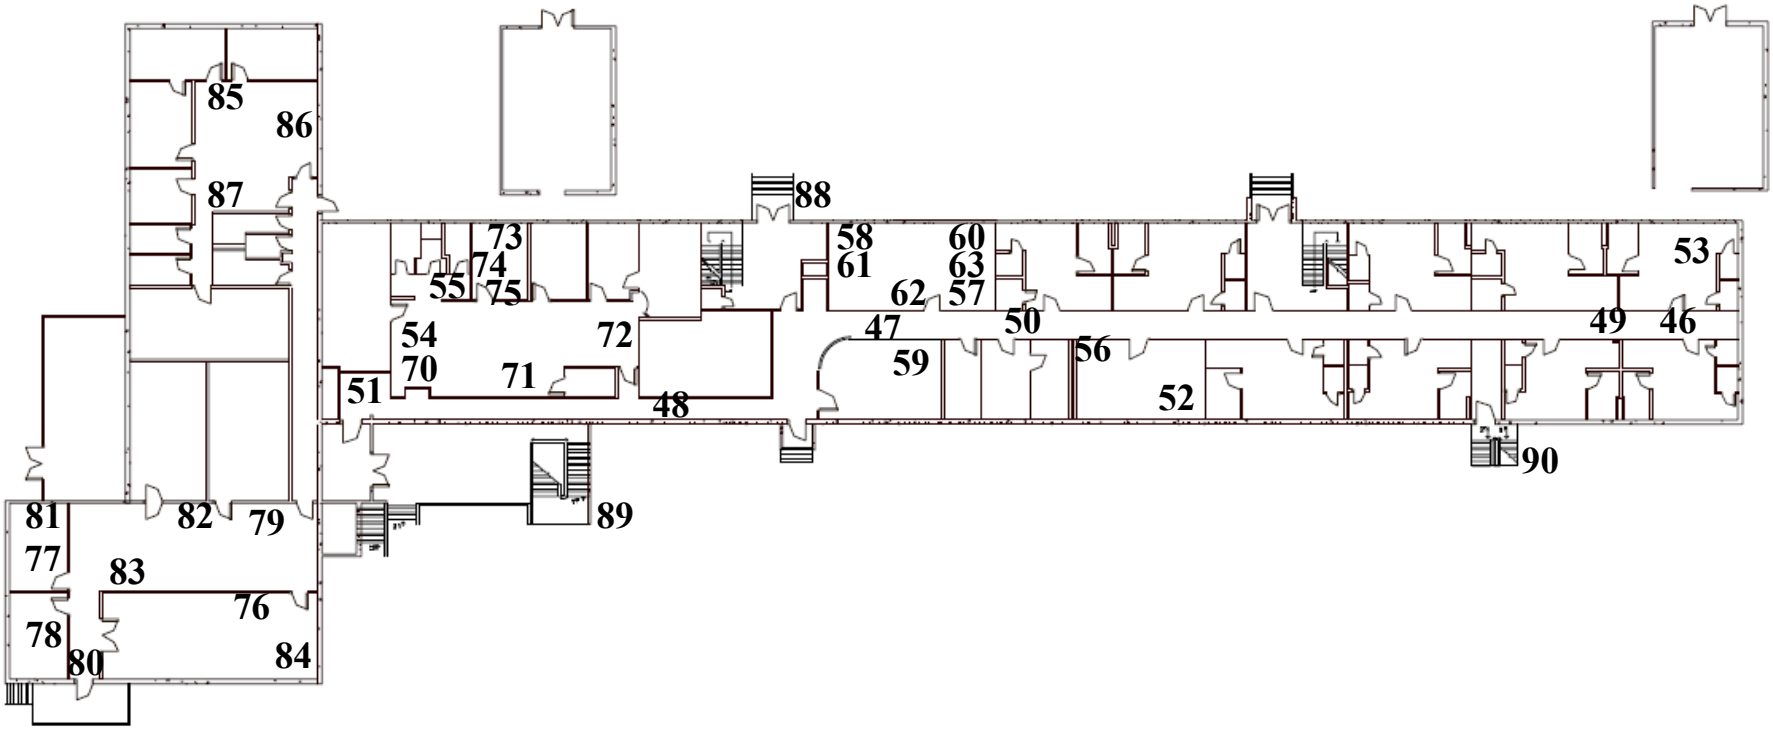

Asbestos Sample Locations ENCON #: 103-08-094 Date: 6/18/2008	# = Asbestos Sample Location [#] = Positive Asbestos Sample Location	Bldg. 2447 – 1st floor Asbestos Sample Location Drawing	N.T.S

ENCON International, Inc.

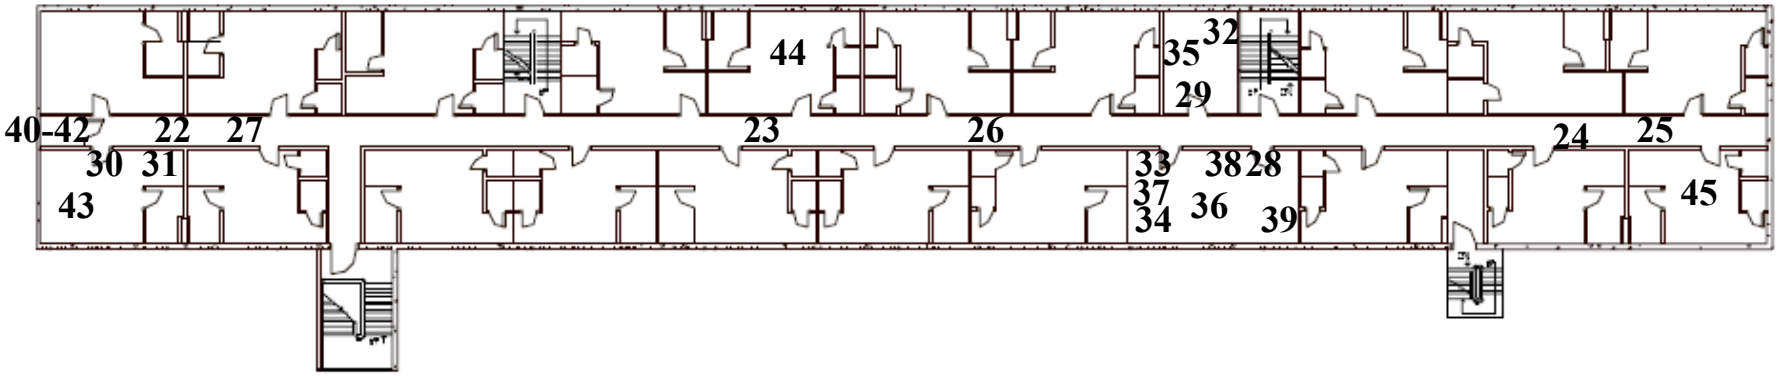

Asbestos Sample Locations ENCON #: 103-08-094 Date: 6/18/2008	# = Asbestos Sample Location # = Positive Asbestos Sample Location	Bldg. 2447 – 2nd floor Asbestos Sample Location Drawing	N.T.S

ENCON International, Inc.

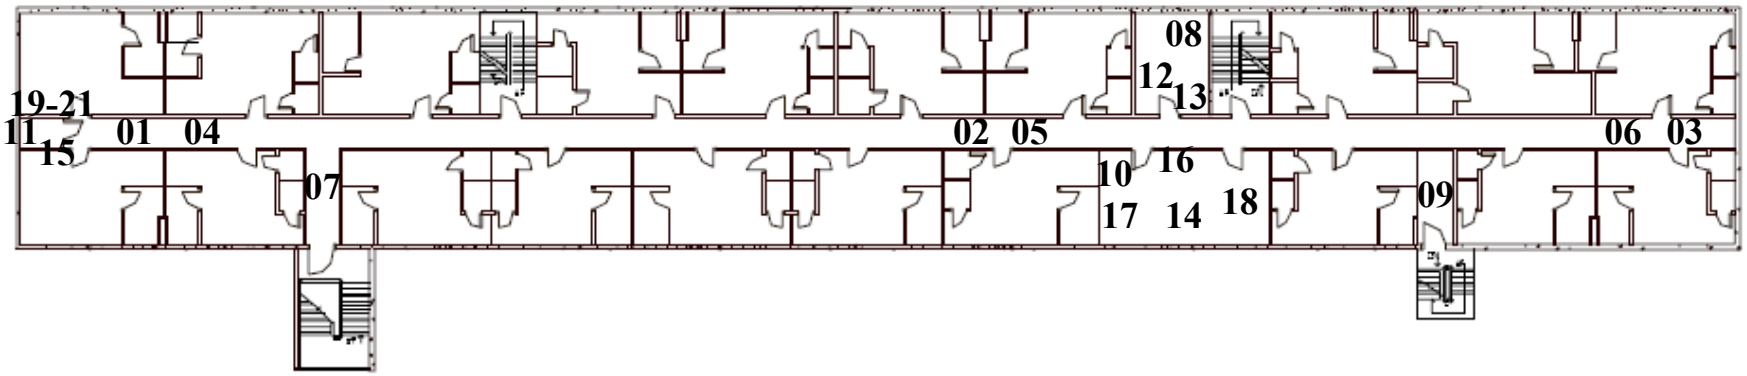

Asbestos Sample Locations ENCON #: 103-08-094 Date: 6/18/2008	# = Asbestos Sample Location $\boxed{\#}$ = Positive Asbestos Sample Location	Bldg. 2447 – 3rd floor Asbestos Sample Location Drawing	N.T.S

ENCON International, Inc.

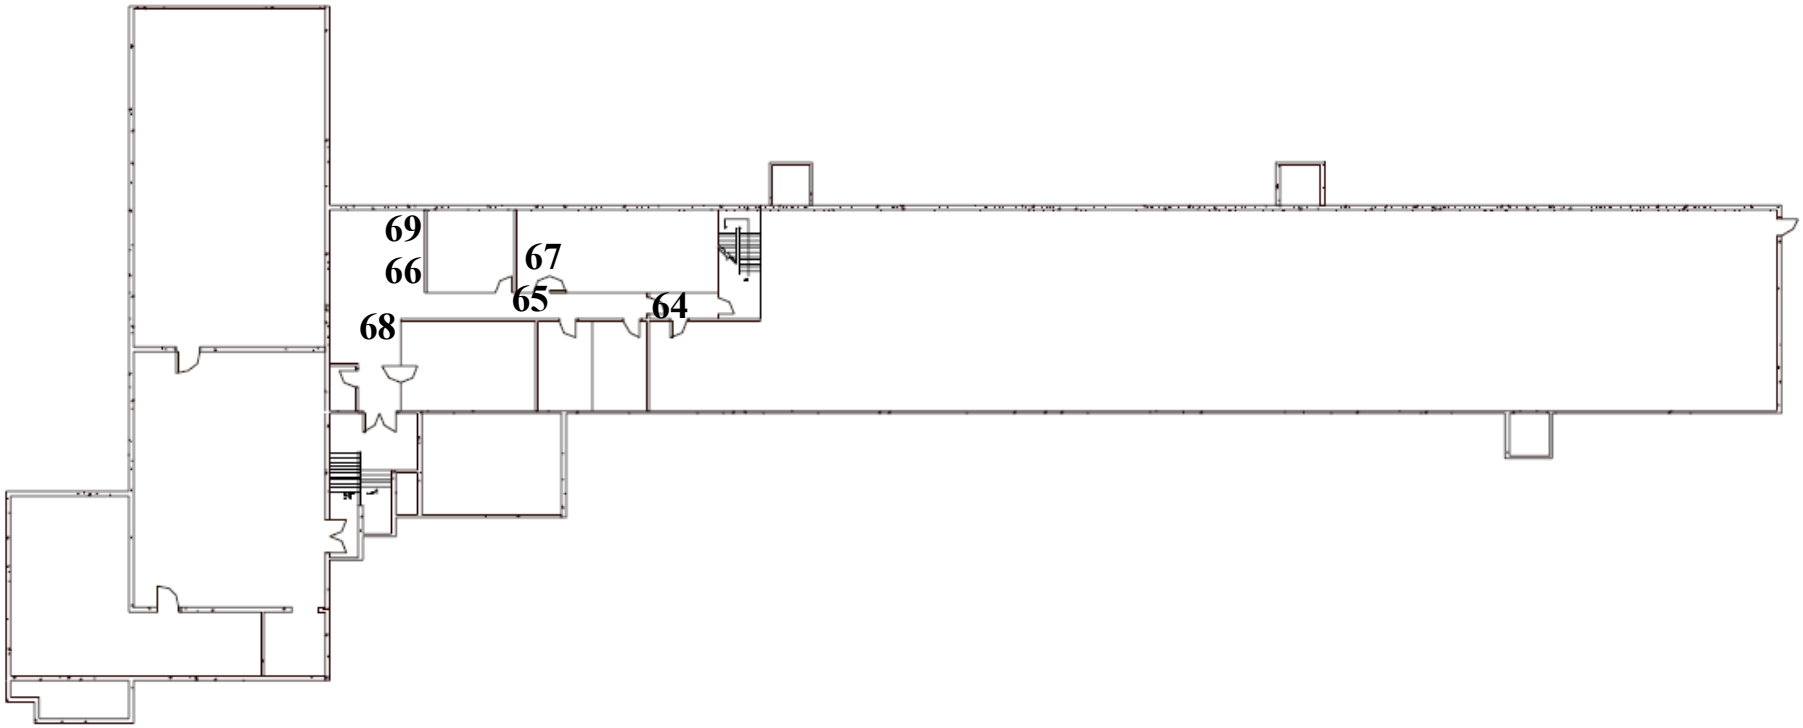

Asbestos Sample Locations **ENCON #: 103-08-094** **Date: 6/18/2008**	**# = Asbestos Sample Location** **# = Positive Asbestos Sample Location**	**Bldg. 2447 – basement** **Asbestos Sample Location Drawing**	**N.T.S**

Photo Log

View of east side of building.

View of stair treads in basement stairwell.

View of window caulking on basement windows.

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1472
Report Date: June 17, 2008
Samples Collected: June 12, 2008
Date Received: June 16, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Building 2447

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-01	5008-1472-01	Light Yellow,Brown / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-02	5008-1472-02	Light Yellow,Brown / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-03	5008-1472-03	Light Yellow,Brown / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-04	5008-1472-04	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-05	5008-1472-05	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-06	5008-1472-06	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-07	5008-1472-07A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-07B	Off White / Joint Tape / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder
	5008-1472-07C	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-08	5008-1472-08A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Gary R. Simmons
Laboratory Manager

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM **TDSHS Asbestos Lab License#: 30-0312 PLM/PCM**

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1472
Report Date: June 17, 2008
Samples Collected: June 12, 2008
Date Received: June 16, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Building 2447

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-08	5008-1472-08B	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-09	5008-1472-09A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-09B	Off White / Joint Tape / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder
	5008-1472-09C	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-10	5008-1472-10A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-10B	Off White / Joint Tape / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder
S-11	5008-1472-11A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-11B	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-12	5008-1472-12A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-12B	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder

Gary R. Simmons
Laboratory Manager

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM
TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1472
Report Date: June 17, 2008
Samples Collected: June 12, 2008
Date Received: June 16, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Building 2447

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-13	5008-1472-13A	Grey / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-13B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-14	5008-1472-14A	Grey / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-14B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-15	5008-1472-15A	Grey / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-15B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-16	5008-1472-16	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-17	5008-1472-17A	Dark Grey / Cove Base / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-17B	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-18	5008-1472-18	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Gary R. Simmons
Laboratory Manager

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM
TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1472
Report Date: June 17, 2008
Samples Collected: June 12, 2008
Date Received: June 16, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Building 2447

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-19	5008-1472-19	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-20	5008-1472-20	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-21	5008-1472-21	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-22	5008-1472-22	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-23	5008-1472-23	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-24	5008-1472-24	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-25	5008-1472-25	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-26	5008-1472-26	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-27	5008-1472-27	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-28	5008-1472-28A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Gary R. Simmons
Laboratory Manager

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM
TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1472
Report Date: June 17, 2008
Samples Collected: June 12, 2008
Date Received: June 16, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Building 2447

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-28	5008-1472-28B	Off White / Joint Tape / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder
	5008-1472-28C	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-29	5008-1472-29A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-29B	Off White / Joint Tape / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder
	5008-1472-29C	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-30	5008-1472-30A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-30B	Off White / Joint Tape / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder
	5008-1472-30C	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-31	5008-1472-31A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-31B	Off White / Joint Tape / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder

Gary R. Simmons
Laboratory Manager

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM **TDSHS Asbestos Lab License#: 30-0312 PLM/PCM**

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1472
Report Date: June 17, 2008
Samples Collected: June 12, 2008
Date Received: June 16, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Building 2447

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-31	5008-1472-31C	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-32	5008-1472-32A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-32B	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-33	5008-1472-33A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-33B	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-34	5008-1472-34A	Grey / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-34B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-35	5008-1472-35A	Grey / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-35B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-36	5008-1472-36A	Grey / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Gary R. Simmons
Laboratory Manager

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM **TDSHS Asbestos Lab License#: 30-0312 PLM/PCM**

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1472
Report Date: June 17, 2008
Samples Collected: June 12, 2008
Date Received: June 16, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Building 2447

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-36	5008-1472-36B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-37	5008-1472-37	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-38	5008-1472-38	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-39	5008-1472-39	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-40	5008-1472-40	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-41	5008-1472-41	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-42	5008-1472-42	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-43	5008-1472-43	Yellow / Carpet Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-44	5008-1472-44	Yellow / Carpet Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-45	5008-1472-45	Yellow / Carpet Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Gary R. Simmons
Laboratory Manager

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM
TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1472
Report Date: June 17, 2008
Samples Collected: June 12, 2008
Date Received: June 16, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Building 2447

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-46	5008-1472-46	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-47	5008-1472-47	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-48	5008-1472-48	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-49	5008-1472-49	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-50	5008-1472-50	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-51	5008-1472-51	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-52	5008-1472-52	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-53	5008-1472-53A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-53B	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-54	5008-1472-54	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Gary R. Simmons
Laboratory Manager

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM
TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1472
Report Date: June 17, 2008
Samples Collected: June 12, 2008
Date Received: June 16, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Building 2447

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-55	5008-1472-55A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-55B	Off White / Joint Tape / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder
	5008-1472-55C	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-56	5008-1472-56A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-56B	Off White / Joint Tape / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder
	5008-1472-56C	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-57	5008-1472-57A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-57B	Off White / Joint Tape / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder
	5008-1472-57C	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-58	5008-1472-58	Yellow / Carpet Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Gary R. Simmons
Laboratory Manager

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM **TDSHS Asbestos Lab License#: 30-0312 PLM/PCM**

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1472
Report Date: June 17, 2008
Samples Collected: June 12, 2008
Date Received: June 16, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Building 2447

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-59	5008-1472-59	Yellow / Carpet Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-60	5008-1472-60	Yellow / Carpet Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-61	5008-1472-61	White,Grey / 2x4 Ceiling Tile / Fibrous / Homogeneous	None Detected	Cellulose 40% Fibrous Glass 10%	Binder
S-62	5008-1472-62	White,Grey / 2x4 Ceiling Tile / Fibrous / Homogeneous	None Detected	Cellulose 40% Fibrous Glass 10%	Binder
S-63	5008-1472-63	White,Grey / 2x4 Ceiling Tile / Fibrous / Homogeneous	None Detected	Cellulose 40% Fibrous Glass 10%	Binder
S-64	5008-1472-64	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-65	5008-1472-65	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-66	5008-1472-66	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-67	5008-1472-67	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-68	5008-1472-68	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Gary R. Simmons
Laboratory Manager

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM **TDSHS Asbestos Lab License#: 30-0312 PLM/PCM**

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1472
Report Date: June 17, 2008
Samples Collected: June 12, 2008
Date Received: June 16, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Building 2447

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-69	5008-1472-69A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-69B	Off White / Joint Tape / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder
S-70	5008-1472-70	Yellow / Carpet Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-71	5008-1472-71	Yellow / Carpet Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-72	5008-1472-72	Yellow / Carpet Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-73	5008-1472-73	Clear,Off White / Carpet Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-74	5008-1472-74	Clear,Off White / Carpet Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-75	5008-1472-75	Clear,Off White / Carpet Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-76	5008-1472-76A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-76B	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10%	Binder

Gary R. Simmons
Laboratory Manager

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM **TDSHS Asbestos Lab License#: 30-0312 PLM/PCM**

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1472
Report Date: June 17, 2008
Samples Collected: June 12, 2008
Date Received: June 16, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Building 2447

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-77	5008-1472-77A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-77B	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-78	5008-1472-78	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-79	5008-1472-79A	Grey / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-79B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-80	5008-1472-80A	Grey / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-80B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-81	5008-1472-81A	Grey / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1472-81B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-82	5008-1472-82	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Gary R. Simmons
Laboratory Manager

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM **TDSHS Asbestos Lab License#: 30-0312 PLM/PCM**

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1472
Report Date: June 17, 2008
Samples Collected: June 12, 2008
Date Received: June 16, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Building 2447

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-83	5008-1472-83	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-84	5008-1472-84	Off White / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-85	5008-1472-85	White,Grey / 2x4 Ceiling Tile / Fibrous / Homogeneous	None Detected	Cellulose 40% Fibrous Glass 10%	Binder
S-86	5008-1472-86	White,Grey / 2x4 Ceiling Tile / Fibrous / Homogeneous	None Detected	Cellulose 40% Fibrous Glass 10%	Binder
S-87	5008-1472-87	White,Grey / 2x4 Ceiling Tile / Fibrous / Homogeneous	None Detected	Cellulose 40% Fibrous Glass 10%	Binder
S-88	5008-1472-88	Beige / Texture,Stucco / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-89	5008-1472-89	Beige / Texture,Stucco / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-90	5008-1472-90	Beige / Texture,Stucco / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Gary R. Simmons
Laboratory Manager

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM
TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

Chain of Custody

Dates Collected: June 12, 2008	**Date Sent: June 13, 2008**
Contact : David Morales	**Remarks:**
Company: ENCON International	**P.O. #:**
Address: 7307 Remcon Circle, Suite 100	
El Paso, TX 79912	**APASI#:** *(For APASI use only)*
Phone: (915) 833-3740	**Fax: (915) 581-2049**

Turn Around Time:
Urgent / ASAP: __ **Rush:** X 24 Hr __ 48 Hr **Routine:** __3 Day __5 Day

Project Name/Number: 103-08-094 (Ft. Bliss, building 2447)

Mycology(Mold) Spore Trap-Air Samples

____ **Fungal/Mold spore count** by Air-O-Cell, Cyclex (d), BioCell, or other spore trap cassette/device

Phase Contrast Microscopy(PCM)-Air Samples

____ **Fiber Concentration** by NIOSH Method 7400 Issue 2

Industrial Hygiene-Air & Bulk Samples

____ **(RCF) Refractory Ceramic Fiber (Bulk) Identification** (Visual Estimation) by Polarized Light Microscopy

Mycology(Mold) Bulk ID Samples

____ **Fungal/Mold Identification** – bulk sample, tape lift, swab

Polarized Light Microscopy(PLM)-Bulk Samples

X **Asbestos Identification** (Visual Estimation) by EPA 600/R-93/116 Method
____ **Asbestos Identification** (Point Count) by EPA 600/M4-82-020 Method
____ **Asbestos Identification** (Soil/Prep) by Gravimetric Reduction

Sample #:	Location / Description:	Volume	Instructions
S-01	Rubberized flooring mastic		
S-02	Rubberized flooring mastic		
S-03	Rubberized flooring mastic		
S-04	Cove base mastic		
S-05	Cove base mastic		
S-06	Cove base mastic		
S-07	Textured drywall/joint compound		
S-08	Textured drywall/joint compound		
S-09	Textured drywall/joint compound		
S-10	Textured drywall/joint compound		

Relinquished by:_____ **Received by:**_____

Date: 06/13/2008 **Time:** 1700 **Date:**_____ **Time:**_____

Sample #:	Location:	Volume	Instructions
S-11	Textured drywall/joint compound		
S-12	Textured drywall/joint compound		
S-13	12” x 12 floor tile & mastic		
S-14	12” x 12 floor tile & mastic		
S-15	12” x 12 floor tile & mastic		
S-16	Cove base mastic		
S-17	Cove base mastic		
S-18	Cove base mastic		
S-19	Cove base mastic		
S-20	Cove base mastic		
S-21	Cove base mastic		
S-22	Rubberized flooring mastic		
S-23	Rubberized flooring mastic		
S-24	Rubberized flooring mastic		
S-25	Cove base mastic		
S-26	Cove base mastic		
S-27	Cove base mastic		
S-28	Textured drywall/joint compound		
S-29	Textured drywall/joint compound		
S-30	Textured drywall/joint compound		
S-31	Textured drywall/joint compound		
S-32	Textured drywall/joint compound		
S-33	Textured drywall/joint compound		
S-34	12” x 12 floor tile & mastic		
S-35	12” x 12 floor tile & mastic		
S-36	12” x 12 floor tile & mastic		
S-37	Cove base mastic		
S-38	Cove base mastic		
S-39	Cove base mastic		
S-40	Cove base mastic		
S-41	Cove base mastic		
S-42	Cove base mastic		
S-43	Carpet mastic		
S-44	Carpet mastic		
S-45	Carpet mastic		

Sample #:	Location:	Volume	Instructions
S-46	Cove base mastic		
S-47	Cove base mastic		
S-48	Cove base mastic		
S-49	Rubberized flooring mastic		
S-50	Rubberized flooring mastic		
S-51	Rubberized flooring mastic		
S-52	Textured drywall/joint compound		
S-53	Textured drywall/joint compound		
S-54	Textured drywall/joint compound		
S-55	Textured drywall/joint compound		
S-56	Textured drywall/joint compound		
S-57	Textured drywall/joint compound		
S-58	Carpet mastic		
S-59	Carpet mastic		
S-60	Carpet mastic		
S-61	2’ x 4’ ceiling panels		
S-62	2’ x 4’ ceiling panels		
S-63	2’ x 4’ ceiling panels		
S-64	Cove base mastic		
S-65	Cove base mastic		
S-66	Cove base mastic		
S-67	Textured drywall/joint compound		
S-68	Textured drywall/joint compound		
S-69	Textured drywall/joint compound		
S-70	Carpet mastic		
S-71	Carpet mastic		
S-72	Carpet mastic		
S-73	Carpet mastic		
S-74	Carpet mastic		
S-75	Carpet mastic		
S-76	Textured drywall/joint compound		
S-77	Textured drywall/joint compound		
S-78	Textured drywall/joint compound		
S-79	12” x 12” floor tile & mastic		
S-80	12” x 12” floor tile & mastic		

Sample #:	Location:	Volume	Instructions
S-81	12” x 12” floor tile & mastic		
S-82	Cove base mastic		
S-83	Cove base mastic		
S-84	Cove base mastic		
S-85	2’ x 4’ ceiling panels		
S-86	2’ x 4’ ceiling panels		
S-87	2’ x 4’ ceiling panels		
S-88	Stucco texture		
S-89	Stucco texture		
S-90	Stucco texture		

ENCON INTERNATIONAL, INC.

Engineering, Environmental & Technical Services

June 13, 2008

Mr. Henry Wilson, PE
General Engineer
DPW-Building 777
Fort Bliss, TX 79916

Phone:(915)568-2300
Via email & hand delivery

RE: LEAD-BASED PAINT INSPECTION
Building 2447
Ft. Bliss, TX 79916

Dear Mr. Wilson:

ENCON International, Inc., (ENCON) has submitted for your review the attached Lead-Based Paint (LBP) Inspection conducted at Building 2447, Fort Bliss, Texas. This inspection was performed of the entire building to address the Occupational Safety and Health Administration (OSHA) lead regulations (29 CFR 1926.62).

This LBP Inspection was performed by Mr. Tim Jones, certified Texas Department of State Health Services (DSHS) Lead Risk Assessor utilizing a NITON XLp 303 AW X-Ray Fluorescence analyzer (XRF) with serial No. 18451.

We appreciate the opportunity to be of service to you. Please call if you have any questions or if we may be of further assistance.

Sincerely,

Alex Woelper, P.E.
Program Manager

Attachments:

- Lead Inspection Report
- Lead Drawings
- Technical Documentation

SUMMARY

ENCON International, Inc, (ENCON) presents the findings of the Lead-Based Paint (LBP) Inspection performed at Building 2447, Ft. Bliss, Texas 79916. The purpose of this LBP inspection was to determine if LBP was present in the areas scheduled for renovation, and if present, which building components contain LBP. This was determined by performing a surface-by-surface investigation of all painted components. This information is necessary in order for contractors to comply with OSHA regulation 29 CFR 1926.62 Safety and Health Regulations for Construction - Lead.

Lead-based Paint means paint or other surface coatings that contain lead equal to or in excess of 1.0 milligrams per square centimeter (mg/cm^2) or more than 0.5%, or 5000 parts per million by weight as established by EPA and HUD regulations. However, for the purposes of this study, ENCON will utilize the lowest "Action Level" setting of the NITON XRF at 0.3 milligrams per square centimeter (mg/cm^2) as the detection limit for lead. **Results indicate that twenty-six (26) of the one hundred fifty-two (152) XRF readings tested at or above the limit of 0.3 mg/cm^2.** The LBP Inspection was conducted by Mr. Tim Jones, a certified Lead Risk Assessor. Results are indicated on a separate drawing and XRF data sheet.

DESCRIPTION OF AREAS INSPECTED

Building 2447 was primarily being used as barracks, housing military personnel on Fort Bliss, Texas. There were also areas that were being used for storage and administrative offices. The building occupied approximately 38,000 SF. The building was a three-story structure with a basement constructed with CMU walls on a concrete foundation. The interior was partitioned with drywall walls. Most of the floor was covered with floor tile and carpeting, but some was painted concrete. At the time this Lead Inspection was performed, the date of construction was not known, but the building appeared to have been repainted over the years. An inventory of the affected painted surfaces was recorded as XRF testing proceeded. See the "LBP Testing Data Sheet."

CALIBRATION OF THE XRF INSTRUMENT

Before proceeding with the investigation of painted surfaces, the XRF was calibrated in accordance to the manufacturer's quality control procedures. The XRF utilized was a Niton XLp 303 AW X-Ray Fluorescence analyzer (XRF) with serial No. 18451. The inspector took three calibration readings at 1.0 mg/cm^2 and at the Action Level of 0.3 mg/cm^2 on a lead calibration film provided by the manufacturer. The measured difference between the initial calibration test and the lead film was within the manufacturer's acceptable calibration tolerance limit ($\leq$ 0.2 mg/cm^2). In accordance with the HUD XRF Performance Characteristic Sheet, the XRF instrument did not require correction for substrate bias for any substrate encountered and the instrument had no inconclusive

range. Calibration of the instrument was also conducted at the conclusion of sampling for the building using the same procedures as the initial calibration check.

XRF READINGS THAT TESTED POSITIVE FOR LEAD (>0.3 mg/cm^2)

No	Component	Substrate	Condition	Color	Room	PbC
5	DOOR	CONCRETE	FAIR	TAN	OUTSIDE	0.7
17	COLUMN	CONCRETE	FAIR	BROWN	OUTSIDE	0.6
18	TREAD	CONCRETE	FAIR	TAN	OUTSIDE	0.7
19	FLOOR	CONCRETE	FAIR	WHITE	PORCH	0.5
26	LADDER	METAL	FAIR	BROWN	STAIR	4.7
30	CEILING	CONCRETE	FAIR	BROWN	JANITOR	0.9
39	CEILING	CONCRETE	FAIR	BROWN	309	0.9
46	FLOOR	CONCRETE	FAIR	GREY	E JANITOR	0.4
47	SIGN POST	METAL	FAIR	BROWN	OUTSIDE	2.6
48	WALL	CONCRETE	FAIR	TAN	OUTSIDE	0.5
63	CEILING	CONCRETE	FAIR	TAN	209	0.8
69	WALL	CONCRETE	FAIR	GREY	STAIR	0.4
97	STRINGER	CONCRETE	FAIR	WHITE	STAIR	0.5
101	COLUMN	CONCRETE	POOR	BROWN	STAIR	0.8
107	WALL	CONCRETE	FAIR	TAN		0.4
108	CEILING	CONCRETE	POOR	GREY		0.4
110	WALL	CONCRETE	FAIR	BROWN		0.4
115	WALL	CONCRETE	FAIR	BROWN	HALL	0.4
117	WALL	CONCRETE	POOR	GREY	STAIR	0.4
125	WALL	CONCRETE	FAIR	BROWN	ENTRANCE	0.4
136	COLUMN	CONCRETE	FAIR	TAN	OUTSIDE	0.5
139	UNDERSIDE	CONCRETE	FAIR	WHITE	OUTSIDE	0.5
142	RISER	CONCRETE	FAIR	BROWN	OUTSIDE	0.4
147	WALL	CONCRETE	FAIR	WHITE	MECH	0.4
148	COLUMN	CONCRETE	FAIR	WHITE	MECH	0.5
149	I-BEAM	METAL	FAIR	TAN	MECH	0.4

Care shall also be taken for surfaces that contain levels of lead below the Action Level stated above for the instrument (0.3 mg/cm^2), which could create lead dust or lead-contaminated soil hazards if the paint is turned into dust by abrasion, scraping, or sanding.

SUMMARY

ENCON has performed a lead-based paint inspection at Building # 2447 Fort Bliss, Texas 79916. The attached drawing indicates the locations where samples were taken.

Inspected by:

Tim Jones
Lead Risk Assessor
DSHS # 2070306

Reviewed by:

David Morales
Lead Risk Assessor
DSHS # 2070809

ENCON International, Inc.

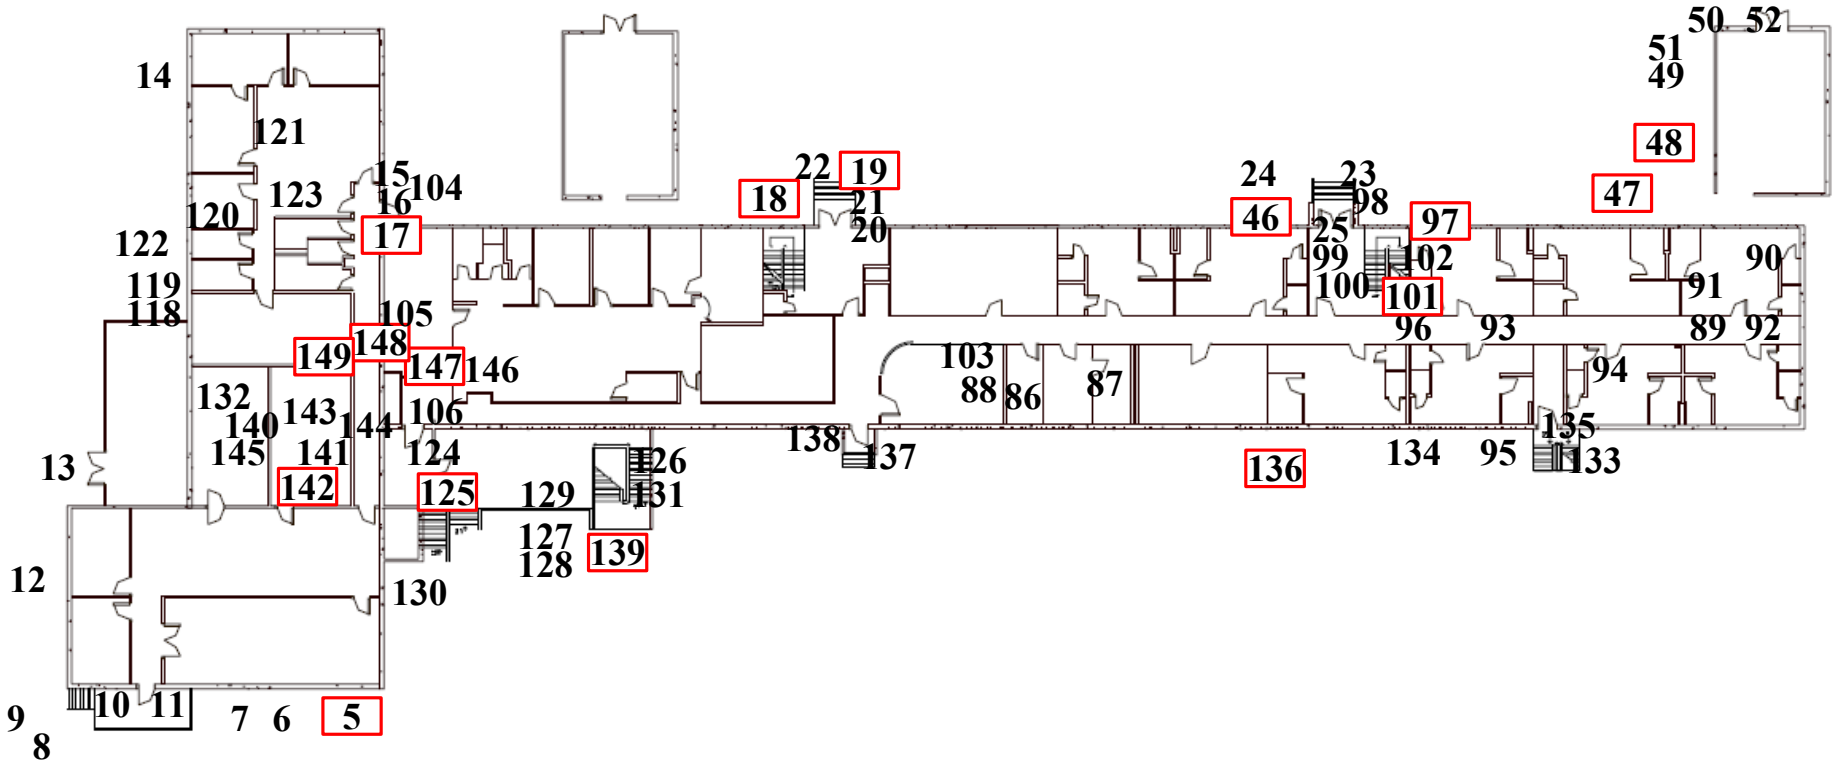

Lead Sample Locations ENCON #: 103-08-094 Date: 6/18/2008	# = Lead Sample Location [# #] = Positive Lead Sample Location	Bldg. 2447 – 1st floor Lead Sample Location Drawing	N.T.S

ENCON International, Inc.

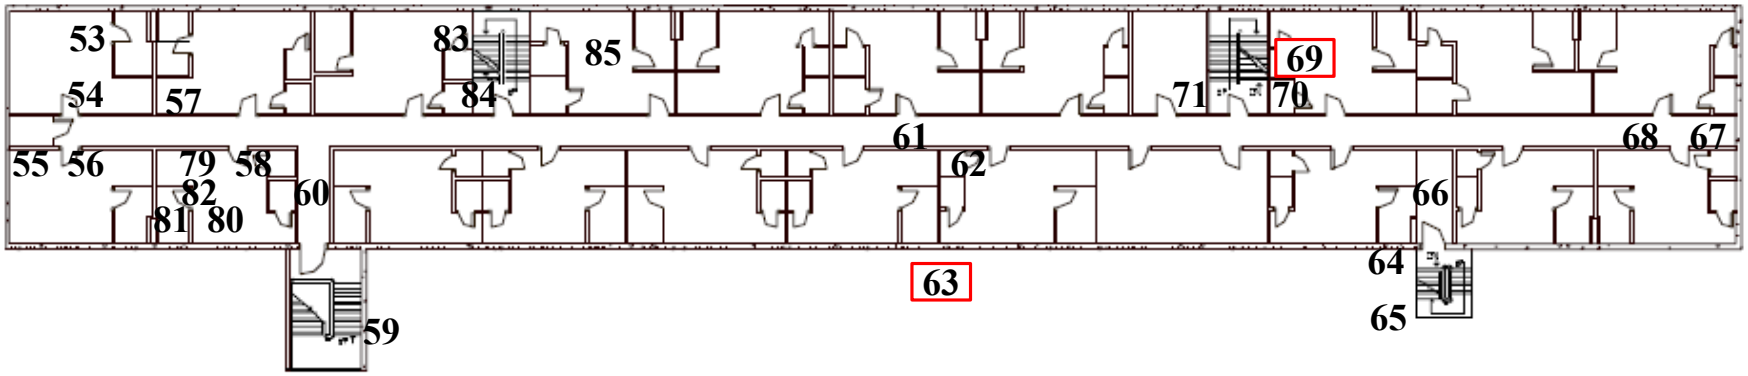

Lead Sample Locations ENCON #: 103-08-094 Date: 6/18/2008	# = Lead Sample Location # # = Positive Lead Sample Location	Bldg. 2447 – 2nd floor Lead Sample Location Drawing	N.T.S

ENCON International, Inc.

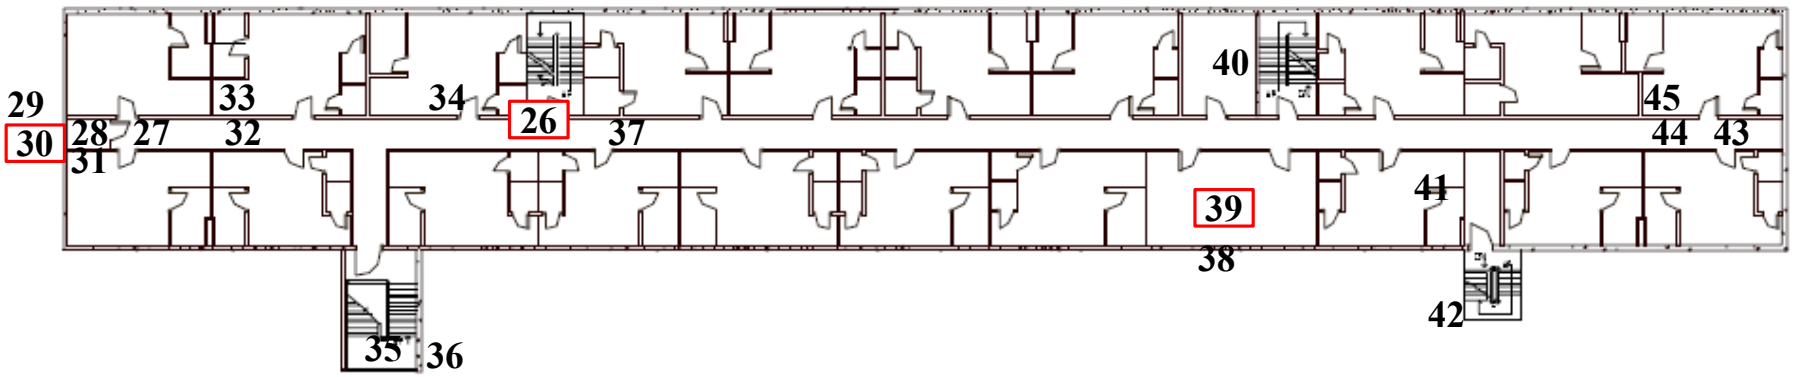

Lead Sample Locations ENCON #: 103-08-094 Date: 6/18/2008	# = Lead Sample Location # # = Positive Lead Sample Location	Bldg. 2447 – 3rd floor Lead Sample Location Drawing	N.T.S

ENCON International, Inc.

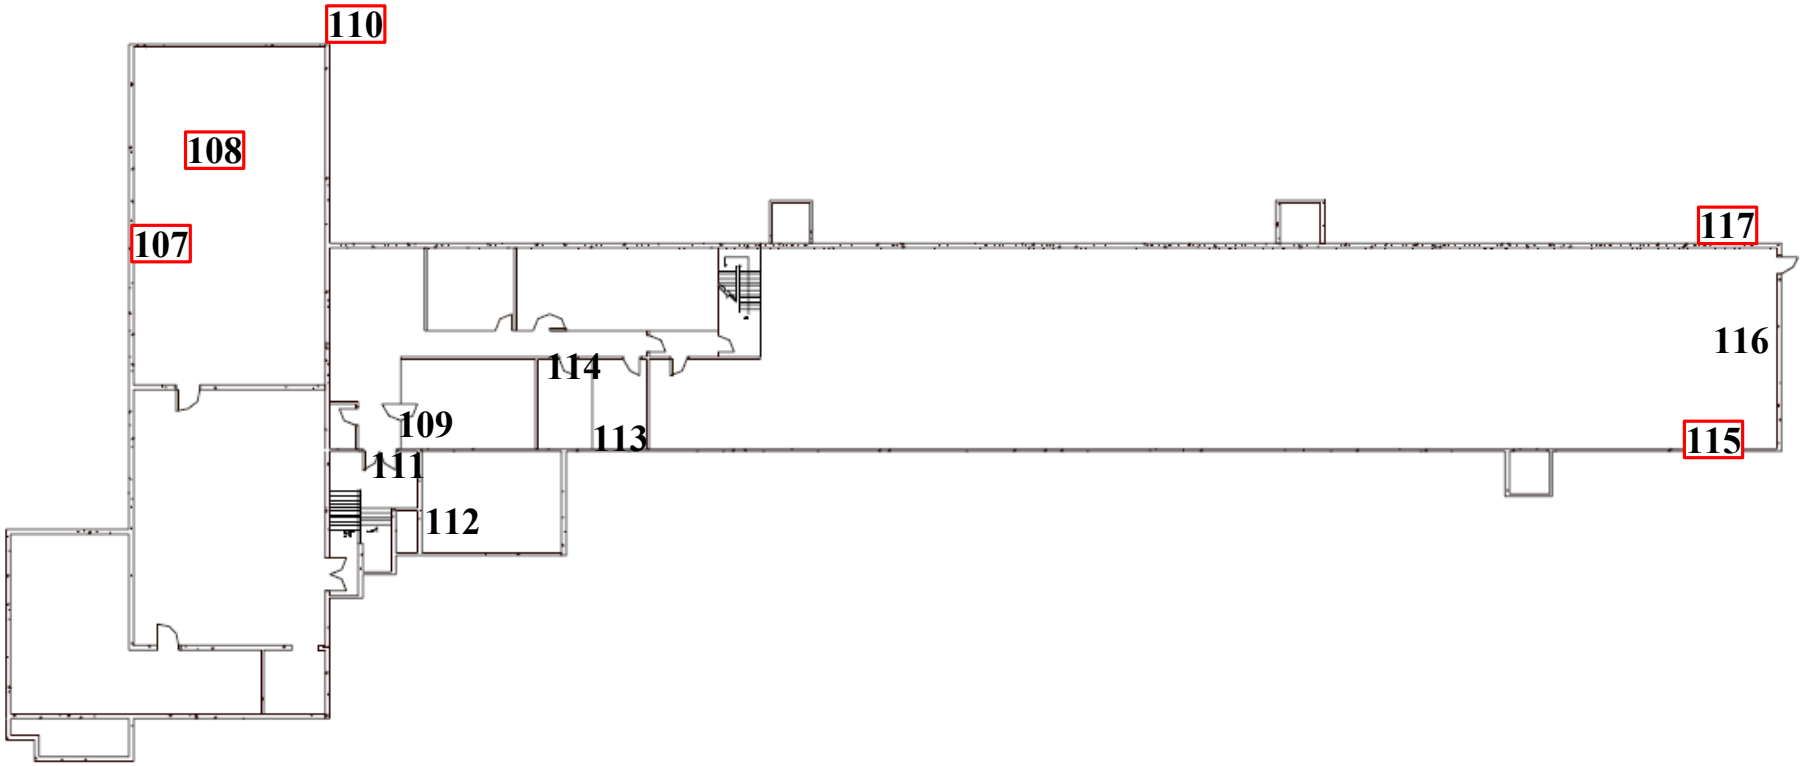

Lead Sample Locations ENCON #: 103-08-094 Date: 6/18/2008	# = Lead Sample Location # # = Positive Lead Sample Location	Bldg. 2447 – Basement Lead Sample Locations Drawing	N.T.S

No	Type	Component	Substrate	Condition	Color	Site	Floor	Room	Misc 1	Results	Action Level	PbC
1	SHUTTER_CAL											10.99
2	**PAINT**		**CALIBRATE**							**Positive**	**0.3**	**0.9**
3	**PAINT**		**CALIBRATE**							**Positive**	**0.3**	**0.4**
4	**PAINT**		**CALIBRATE**							**Positive**	**0.3**	**0.3**
5	**PAINT**	**COLUMN**	**CONCRETE**	**FAIR**	**TAN**	**BLDG 2447**	**FIRST**	**OUTSIDE**		**Positive**	**0.3**	**0.7**
6	PAINT	WALL	METAL	FAIR	TAN	BLDG 2447	FIRST	OUTSIDE	VENT	Negative	0.3	0
7	PAINT	WALL	STUCCO	FAIR	BROWN	BLDG 2447	FIRST	OUTSIDE		Negative	0.3	0
8	PAINT	BUMPER	METAL	POOR	BROWN	BLDG 2447	FIRST	OUTSIDE		Negative	0.3	0
9	PAINT	RAIL	METAL	FAIR	BROWN	BLDG 2447	FIRST	OUTSIDE		Negative	0.3	0
10	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2447	FIRST	OUTSIDE		Negative	0.3	0
11	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2447	FIRST	OUTSIDE	CASING	Negative	0.3	0
12	PAINT	WALL	STUCCO	FAIR	BROWN	BLDG 2447	FIRST	OUTSIDE		Negative	0.3	0
13	PAINT	GATE	METAL	FAIR	BROWN	BLDG 2447	FIRST	OUTSIDE		Negative	0.3	0.01
14	PAINT	WINDOW	CONCRETE	FAIR	TAN	BLDG 2447	FIRST	OUTSIDE	SHADE	Negative	0.3	0.01
15	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2447	FIRST	OUTSIDE		Negative	0.3	0
16	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2447	FIRST	OUTSIDE	CASING	Negative	0.3	0
17	**PAINT**	**COLUMN**	**CONCRETE**	**FAIR**	**TAN**	**BLDG 2447**	**FIRST**	**OUTSIDE**		**Positive**	**0.3**	**0.6**
18	**PAINT**	**TREAD**	**CONCRETE**	**FAIR**	**GREY**	**BLDG 2447**	**FIRST**	**OUTSIDE**		**Positive**	**0.3**	**0.7**
19	**PAINT**	**FLOOR**	**CONCRETE**	**FAIR**	**GREY**	**BLDG 2447**	**FIRST**	**PORCH**		**Positive**	**0.3**	**0.5**
20	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2447	FIRST	OUTSIDE		Negative	0.3	0
21	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2447	FIRST	OUTSIDE	CASING	Negative	0.3	0
22	PAINT	RAIL	METAL	FAIR	BROWN	BLDG 2447	FIRST	OUTSIDE		Negative	0.3	0
23	PAINT	RAIL	METAL	FAIR	BROWN	BLDG 2447	FIRST	OUTSIDE		Negative	0.3	0
24	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2447	FIRST	OUTSIDE	CASING	Null	0.3	0
25	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2447	FIRST	OUTSIDE		Negative	0.3	0
26	**PAINT**	**LADDER**	**METAL**	**FAIR**	**TAN**	**BLDG 2447**	**THIRD**	**STAIR**		**Positive**	**0.3**	**4.7**
27	PAINT	DOOR	METAL	FAIR	TAN	BLDG 2447	THIRD	JANITOR		Negative	0.3	0
28	PAINT	DOOR	METAL	FAIR	TAN	BLDG 2447	THIRD	JANITOR	CASING	Negative	0.3	0
29	PAINT	WALL	DRYWALL	FAIR	TAN	BLDG 2447	THIRD	JANITOR		Negative	0.3	0
30	**PAINT**	**CEILING**	**CONCRETE**	**FAIR**	**TAN**	**BLDG 2447**	**THIRD**	**JANITOR**		**Positive**	**0.3**	**0.9**
31	PAINT	WALL	CONCRETE	FAIR	TAN	BLDG 2447	THIRD	JANITOR		Null	0.3	0
32	PAINT	CEILING	DRYWALL	FAIR	TAN	BLDG 2447	THIRD	HALL		Negative	0.3	0
33	PAINT	WALL	DRYWALL	FAIR	TAN	BLDG 2447	THIRD	HALL		Negative	0.3	0
34	PAINT	DOOR	METAL	FAIR	TAN	BLDG 2447	THIRD	HALL-324		Negative	0.3	0
35	PAINT	DOOR	METAL	FAIR	TAN	BLDG 2447	THIRD	HALL-EXIT	CASING	Negative	0.3	0
36	PAINT	DOOR	METAL	FAIR	TAN	BLDG 2447	THIRD	HALL-EXIT		Negative	0.3	0
37	PAINT	DOOR	METAL	FAIR	TAN	BLDG 2447	THIRD	HALL-319		Null	0.3	0
38	PAINT	WALL	DRYWALL	FAIR	TAN	BLDG 2447	THIRD	HALL-309		Negative	0.3	0
39	**PAINT**	**CEILING**	**CONCRETE**	**FAIR**	**WHITE**	**BLDG 2447**	**THIRD**	**309**		**Positive**	**0.3**	**0.9**
40	PAINT	RAIL	METAL	FAIR	TAN	BLDG 2447	THIRD	STAIR		Negative	0.3	0.07
41	PAINT	WALL	DRYWALL	FAIR	TAN	BLDG 2447	THIRD	HALL		Negative	0.3	0
42	PAINT	DOOR	METAL	FAIR	TAN	BLDG 2447	THIRD	HALL	CASING	Negative	0.3	0

No	Type	Component	Substrate	Condition	Color	Site	Floor	Room	Misc 1	Results	Action Level	PbC
43	PAINT	WALL	DRYWALL	FAIR	TAN	BLDG 2447	THIRD	E JANITOR		Negative	0.3	0
44	PAINT	CEILING	DRYWALL	FAIR	TAN	BLDG 2447	THIRD	E JANITOR		Negative	0.3	0
45	PAINT	WALL	TILE	FAIR	TAN	BLDG 2447	THIRD	E JANITOR		Negative	0.3	0.02
46	**PAINT**	**FLOOR**	**CONCRETE**	**FAIR**	**GREY**	**BLDG 2447**	**FIRST**	**OUTSIDE**		**Positive**	**0.3**	**0.4**
47	**PAINT**	**SIGN POST**	**METAL**	**FAIR**	**BROWN**	**BLDG 2447**	**FIRST**	**OUTSIDE**		**Positive**	**0.3**	**2.6**
48	**PAINT**	**WALL**	**CONCRETE**	**FAIR**	**TAN**	**BLDG 2447**	**FIRST**	**OUTSIDE**		**Positive**	**0.3**	**0.5**
49	PAINT	CHILLER	METAL	FAIR	TAN	BLDG 2447	FIRST	OUTSIDE	WALL	Negative	0.3	0
50	PAINT	CHILLER	METAL	FAIR	SILVER	BLDG 2447	FIRST	OUTSIDE	INTERIOR	Negative	0.3	0
51	PAINT	CHILLER	METAL	FAIR	SILVER	BLDG 2447	FIRST	OUTSIDE	INTERIOR	Negative	0.3	0
52	PAINT	GATE	METAL	FAIR	BROWN	BLDG 2447	FIRST	OUTSIDE		Negative	0.3	0.02
53	PAINT	DOOR	METAL	FAIR	TAN	BLDG 2447	SECOND	JANITOR 228		Negative	0.3	0
54	PAINT	DOOR	METAL	FAIR	TAN	BLDG 2447	SECOND	JANITOR 228	CASING	Negative	0.3	0
55	PAINT	WALL	DRYWALL	FAIR	TAN	BLDG 2447	SECOND	JANITOR 228		Null	0.3	0
56	PAINT	HANGER	METAL	FAIR	TAN	BLDG 2447	SECOND	JANITOR 228		Negative	0.3	0
57	PAINT	WALL	DRYWALL	FAIR	TAN	BLDG 2447	SECOND	HALL		Negative	0.3	0
58	PAINT	DOOR	METAL	FAIR	TAN	BLDG 2447	SECOND	225		Negative	0.3	0
59	PAINT	DOOR	METAL	FAIR	TAN	BLDG 2447	SECOND	EXIT	CASING	Negative	0.3	0
60	PAINT	DOOR	METAL	FAIR	TAN	BLDG 2447	SECOND	EXIT		Negative	0.3	0
61	PAINT	DOOR	METAL	FAIR	TAN	BLDG 2447	SECOND	218		Negative	0.3	0
62	PAINT	WALL	DRYWALL	FAIR	WHITE	BLDG 2447	SECOND	209		Negative	0.3	0
63	**PAINT**	**CEILING**	**CONCRETE**	**FAIR**	**TAN**	**BLDG 2447**	**SECOND**	**209**		**Positive**	**0.3**	**0.8**
64	PAINT	DOOR	METAL	FAIR	TAN	BLDG 2447	SECOND	EXIT		Negative	0.3	0
65	PAINT	DOOR	METAL	FAIR	TAN	BLDG 2447	SECOND	EXIT	CASING	Negative	0.3	0
66	PAINT	WALL	DRYWALL	FAIR	TAN	BLDG 2447	SECOND	HALL		Negative	0.3	0
67	PAINT	WALL	DRYWALL	FAIR	TAN	BLDG 2447	SECOND	JANITOR		Negative	0.3	0
68	PAINT	CEILING	DRYWALL	FAIR	TAN	BLDG 2447	SECOND	JANITOR		Negative	0.3	0
69	**PAINT**	**WALL**	**CONCRETE**	**FAIR**	**TAN**	**BLDG 2447**	**SECOND**	**STAIR**		**Positive**	**0.3**	**0.4**
70	PAINT	PIPE	CONCRETE	FAIR	TAN	BLDG 2447	SECOND	STAIR		Negative	0.3	0
71	PAINT	RAIL	CONCRETE	FAIR	TAN	BLDG 2447	SECOND	STAIR		Negative	0.3	0
72	**PAINT**		**CALIBRATE**							**Positive**	**0.3**	**1.2**
73	**PAINT**		**CALIBRATE**							**Positive**	**0.3**	**0.3**
74	**PAINT**		**CALIBRATE**							**Positive**	**0.3**	**0.3**
75	SHUTTER_CAL											10.7
76	**PAINT**		**CALIBRATE**							**Positive**	**0.3**	**1**
77	**PAINT**		**CALIBRATE**							**Positive**	**0.3**	**0.3**
78	**PAINT**		**CALIBRATE**							**Positive**	**0.3**	**0.4**
79	PAINT	WALL	DRYWALL		WHITE	BLDG 2447	SECOND	225		Negative	0.3	0
80	PAINT	CEILING	DRYWALL		WHITE	BLDG 2447	SECOND	225		Negative	0.3	0
81	PAINT	WALL	DRYWALL		BLUE	BLDG 2447	SECOND	225		Negative	0.3	0
82	PAINT	DOOR	METAL		TAN	BLDG 2447	SECOND	225 BATH		Negative	0.3	0
83	PAINT	RAIL	METAL		TAN	BLDG 2447	SECOND	STAIR		Negative	0.3	0

No	Type	Component	Substrate	Condition	Color	Site	Floor	Room	Misc 1	Results	Action Level	PbC
84	PAINT	PIPE	METAL		TAN	BLDG 2447	SECOND	STAIR		Negative	0.3	0
85	PAINT	CEILING	CONCRETE		TAN	BLDG 2447	SECOND	STAIR		Negative	0.3	0
86	PAINT	WALL	DRYWALL		WHITE	BLDG 2447	FIRST	LAUNDRY		Negative	0.3	0
87	PAINT	CEILING	DRYWALL		WHITE	BLDG 2447	FIRST	LAUNDRY		Negative	0.3	0
88	PAINT	WALL	DRYWALL		GREY	BLDG 2447	FIRST	LAUNDRY		Negative	0.3	0
89	PAINT	WALL	DRYWALL		WHITE	BLDG 2447	FIRST	JANITOR		Negative	0.3	0
90	PAINT	CLOSET	WOOD		WHITE	BLDG 2447	FIRST	101	SHELF	Negative	0.3	0
91	PAINT	CEILING	DRYWALL		WHITE	BLDG 2447	FIRST	101	SHELF	Negative	0.3	0
92	PAINT	CEILING	DRYWALL		WHITE	BLDG 2447	FIRST	JANITOR	SHELF	Negative	0.3	0
93	PAINT	CEILING	DRYWALL		WHITE	BLDG 2447	FIRST	HALL		Negative	0.3	0
94	PAINT	WALL	DRYWALL		TAN	BLDG 2447	FIRST	HALL		Negative	0.3	0
95	PAINT	DOOR	METAL		TAN	BLDG 2447	FIRST	EXIT		Negative	0.3	0
96	PAINT	WALL	DRYWALL		TAN	BLDG 2447	FIRST	HALL		Negative	0.3	0
97	**PAINT**	**STRINGER**	**CONCRETE**		**TAN**	**BLDG 2447**	**FIRST**	**STAIR**		**Positive**	**0.3**	**0.5**
98	PAINT	WALL	CONCRETE		TAN	BLDG 2447	FIRST	STAIR		Negative	0.3	0
99	PAINT	RAIL	METAL		BROWN	BLDG 2447	FIRST	STAIR		Null	0.3	0.04
100	PAINT	RAIL	METAL		BROWN	BLDG 2447	FIRST	STAIR		Negative	0.3	0.13
101	**PAINT**	**COLUMN**	**CONCRETE**		**TAN**	**BLDG 2447**	**FIRST**	**STAIR**		**Positive**	**0.3**	**0.8**
102	PAINT	CEILING	DRYWALL		WHITE	BLDG 2447	FIRST	STAIR		Null	0.3	0
103	PAINT	WALL	METAL		WHITE	BLDG 2447	FIRST	MAIL	VENT	Negative	0.3	0
104	PAINT	WALL	METAL		TAN	BLDG 2447	FIRST	115		Negative	0.3	0
105	PAINT	WALL	DRYWALL		BLUE	BLDG 2447	FIRST	115		Negative	0.3	0
106	PAINT	DOOR	METAL		TAN	BLDG 2447	FIRST	115		Negative	0.3	0
107	**PAINT**	**WALL**	**CONCRETE**		**WHITE**	**BLDG 2447**	**BASEMENT**			**Positive**	**0.3**	**0.4**
108	**PAINT**	**CEILING**	**CONCRETE**		**WHITE**	**BLDG 2447**	**BASEMENT**			**Positive**	**0.3**	**0.4**
109	PAINT	FLOOR	CONCRETE		GREY	BLDG 2447	BASEMENT			Negative	0.3	0.03
110	**PAINT**	**WALL**	**CONCRETE**		**WHITE**	**BLDG 2447**	**BASEMENT**			**Positive**	**0.3**	**0.4**
111	PAINT	WALL	CMU		WHITE	BLDG 2447	BASEMENT			Negative	0.3	0
112	PAINT	WALL	WOOD	FAIR	WHITE	BLDG 2447	BASEMENT	6		Negative	0.3	0
113	PAINT	DOOR	METAL	FAIR	BEIGE	BLDG 2447	BASEMENT	4		Negative	0.3	0
114	PAINT	DUCT	METAL	FAIR	BEIGE	BLDG 2447	BASEMENT	4		Negative	0.3	0
115	**PAINT**	**WALL**	**CONCRETE**	**FAIR**	**WHITE**	**BLDG 2447**	**BASEMENT**	**HALL**		**Positive**	**0.3**	**0.4**
116	PAINT	RAIL	METAL	FAIR	BROWN	BLDG 2447	BASEMENT	HALL		Negative	0.3	0.17
117	**PAINT**	**WALL**	**CONCRETE**	**FAIR**	**WHITE**	**BLDG 2447**	**BASEMENT**	**STAIR**		**Positive**	**0.3**	**0.4**
118	PAINT	WALL	DRYWALL	FAIR	WHITE	BLDG 2447	FIRST	ORDERLY RM		Negative	0.3	0.02
119	PAINT	WALL	DRYWALL	FAIR	WHITE	BLDG 2447	FIRST	ORDERLY RM		Negative	0.3	0
120	PAINT	DOOR	METAL	FAIR	TAN	BLDG 2447	FIRST	ORDERLY RM 125	CASING	Negative	0.3	0
121	PAINT	DUCT	DRYWALL	FAIR	WHITE	BLDG 2447	FIRST	ORDERLY RM		Null	0.3	0
122	PAINT	WALL	DRYWALL	FAIR	WHITE	BLDG 2447	FIRST	ORDERLY RM		Null	0.3	0
123	PAINT	COLUMN	DRYWALL	FAIR	WHITE	BLDG 2447	FIRST	ORDERLY RM		Negative	0.3	0
124	PAINT	WALL	CONCRETE	FAIR	TAN	BLDG 2447	FIRST	ENTRANCE		Null	0.3	0

No	Type	Component	Substrate	Condition	Color	Site	Floor	Room	Misc 1	Results	Action Level	PbC
125	**PAINT**	**WALL**	**CONCRETE**	**FAIR**	**TAN**	**BLDG 2447**	**FIRST**	**ENTRANCE**		**Positive**	**0.3**	**0.4**
126	PAINT	WALL	CMU	FAIR	TAN	BLDG 2447	FIRST	ARMS ROOM		Negative	0.3	0.01
127	PAINT	WALL	CONCRETE	FAIR	TAN	BLDG 2447	FIRST	ARMS ROOM		Null	0.3	0.01
128	PAINT	WALL	CONCRETE	FAIR	TAN	BLDG 2447	FIRST	ARMS ROOM		Negative	0.3	0
129	PAINT	DOOR	METAL	FAIR	TAN	BLDG 2447	FIRST	ARMS ROOM		Negative	0.3	0.01
130	PAINT	WALL	DRYWALL	FAIR	TAN	BLDG 2447	FIRST	ARMS ROOM		Negative	0.3	0
131	PAINT	DOOR	METAL	FAIR	TAN	BLDG 2447	FIRST	ARMS ROOM		Negative	0.3	0
132	PAINT	WALL	DRYWALL	FAIR	WHITE	BLDG 2447	FIRST	HALL		Negative	0.3	0
133	PAINT	COLUMN	CONCRETE	FAIR	TAN	BLDG 2447	FIRST	OUTSIDE		Negative	0.3	0.01
134	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2447	FIRST	OUTSIDE		Negative	0.3	0
135	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2447	FIRST	OUTSIDE	CASING	Negative	0.3	0
136	**PAINT**	**COLUMN**	**CONCRETE**	**FAIR**	**BROWN**	**BLDG 2447**	**FIRST**	**OUTSIDE**		**Positive**	**0.3**	**0.5**
137	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2447	FIRST	OUTSIDE		Negative	0.3	0
138	PAINT	FLOOR	CONCRETE	FAIR	GREY	BLDG 2447	FIRST	OUTSIDE		Null	0.3	0
139	**PAINT**	**UNDERSIDE**	**CONCRETE**	**FAIR**	**TAN**	**BLDG 2447**	**FIRST**	**OUTSIDE**		**Positive**	**0.3**	**0.5**
140	PAINT	TREAD	CONCRETE	FAIR	GREY	BLDG 2447	FIRST	OUTSIDE		Negative	0.3	0.01
141	PAINT	RISER	CONCRETE	FAIR	GREY	BLDG 2447	FIRST	OUTSIDE		Null	0.3	0.01
142	**PAINT**	**RISER**	**CONCRETE**	**FAIR**	**GREY**	**BLDG 2447**	**FIRST**	**OUTSIDE**		**Positive**	**0.3**	**0.4**
143	PAINT	CEILING	CONCRETE	FAIR	TAN	BLDG 2447	FIRST	OUTSIDE		Null	0.3	0
144	PAINT	THRESHOLD	CONCRETE	FAIR	RED	BLDG 2447	FIRST	OUTSIDE		Negative	0.3	0.02
145	PAINT	THRESHOLD	CONCRETE	FAIR	RED	BLDG 2447	BASEMENT	MECH		Negative	0.3	0.01
146	PAINT	FLOOR	CONCRETE	FAIR	GREY	BLDG 2447	BASEMENT	MECH		Negative	0.3	0.01
147	**PAINT**	**WALL**	**CONCRETE**	**FAIR**	**TAN**	**BLDG 2447**	**BASEMENT**	**MECH**		**Positive**	**0.3**	**0.4**
148	**PAINT**	**COLUMN**	**CONCRETE**	**FAIR**	**TAN**	**BLDG 2447**	**BASEMENT**	**MECH**		**Positive**	**0.3**	**0.5**
149	**PAINT**	**I-BEAM**	**METAL**	**FAIR**	**TAN**	**BLDG 2447**	**BASEMENT**	**MECH**		**Positive**	**0.3**	**0.4**
150	**PAINT**		**CALIBRATE**							**Positive**	**0.3**	**1**
151	**PAINT**		**CALIBRATE**							**Positive**	**0.3**	**0.3**
152	**PAINT**		**CALIBRATE**							**Positive**	**0.3**	**0.3**