ENCON International, Inc.
Engineering, Environmental, & Technical Services

July 3, 2008

Mr. Henry Wilson
Asbestos & Lead Manager
DPW, Bldg. 777
Fort Bliss, TX 79916

Phone: (915) 568-2300
Fax: (915) 568-4304

RE: SUBMITTAL OF ASBESTOS & LEAD SURVEY REPORTS
Ft. Bliss Bldg. #2417
ENCON Project #103-08-094

Dear Mr. Wilson,

This document summarizes the Asbestos & Lead Survey Report for the subject facility. The below-listed information was utilized to complete the Scope of Work Tasks:

Project Location and/or Room No. Whole Bldg.
Brief SOW: Performed sampling prior to demolition or renovation activities. **ASBESTOS –**The visual inspection indicated that no suspect asbestos materials were present during the asbestos survey. **LEAD** – Results indicate that twenty-four (24) of the one hundred twenty-one (121) XRF readings tested at or above the limit of 0.3 mg/cm^2.

Technical Summary	Were Found	Were Not Found	Not Tested
1. Asbestos Containing Materials **(>1 %)**		X	
2. Lead Based Paint Materials	X		

Contact me with any technical questions, or follow-up needs that you may have.

Sincerely:

Alex Woelper P.E.
Project Manager

Attachments:

- **Asbestos & Lead Survey Reports**

ASBESTOS SURVEY REPORT
BUILDING 2417
FORT BLISS, TEXAS 79916

Prepared for:
Mr. Henry Wilson, P.E.
DPW
Building 777
Fort Bliss, Texas 79916

Prepared by:
ENCON International, Inc.
7307 Remcon Circle,
Suite 103
El Paso, Texas 79912

Date of Inspection:
June 24, 2008

ENCON Project No. 103-08-094

ENCON INTERNATIONAL, INC.

Engineering, Environmental & Technical Services

June 26, 2008

Mr. Henry Wilson, P.E.
Asbestos & Lead Manager
DPW, Bldg. 777
Fort Bliss, TX 79916

Phone: (915) 568-2300
Via email & hand delivery

RE: ASBESTOS SURVEY REPORT
Building 2417
Fort Bliss, TX 79916

Dear Mr. Wilson,

ENCON International, Inc., (ENCON) has submitted for your review the attached Asbestos Survey Report. This Asbestos Survey was conducted in accordance with Asbestos National Emissions Standards for Hazardous Air Pollutants (NESHAP): 40 CFR Part 61, Subpart M. Sampling protocols were performed in accordance with the Texas Asbestos Health Protection Rules (TAHPR).

This Asbestos Survey was properly performed by ENCON DSHS licensed personnel. ENCON's personnel have been trained and are in compliance with Texas Department of State Health Services (DSHS) regulations. If you have any questions regarding this Asbestos Survey, please feel free to contact us at your convenience.

Sincerely,

Alex Woelper, P.E.
Program Manager

Attachments:

- Asbestos Survey Report
- Asbestos Drawings
- Photo Log
- Laboratory Documentation

ASBESTOS SURVEY REPORT
Ft. Bliss, Bldg. 2417

SUMMARY

ENCON International, Inc. (ENCON) personnel performed an Asbestos Inspection of a structure designated as "Building 2417" on Fort Bliss, Texas. The following are the field sample collection and analysis results for this inspection. The inspection was conducted to ensure compliance with NESHAP – 40 CFR Part 61, Subpart M, which states that "prior to the commencement of the demolition or renovation, thoroughly inspect the affected facility or part of the facility where the demolition or renovation operation(s) will occur for the presence of asbestos, including Category I and Category II non-friable ACM. "

The sample collection and subsequent laboratory analytical results indicated that Asbestos was not detected in the collected samples.

INTRODUCTION

This Asbestos Survey was performed by Mr. David Morales on June 24th, 2008. This Asbestos Survey was conducted in accordance with Asbestos National Emissions Standards for Hazardous Air Pollutants (NESHAP): 40 CFR Part 61, Subpart M. Sampling protocols were performed in accordance with the Texas Asbestos Health Protection Rules (TAHPR). Building 2417 was to undergo renovations and was visually inspected and it was determined that the suspect asbestos-containing materials could be divided into forty-three (43) homogeneous areas, including the following: roof penetration sealant, rubberized flooring mastic (4 types), 12" x 12" floor tile & mastic (11 types), cove base mastic (6 types), textured drywall/joint compound (8 types), caulking (3 types), carpet mastic (3 types), popcorn ceiling texture (2 types), 2' x 4' ceiling panels (2 types), stair/landing tread mastic, and stucco textured (2 types).

DESCRIPTION

Building 2417 was being used as military personnel housing on Fort Bliss, Texas. The building occupied approximately 38,527 SF. The building was a three-story structure constructed with CMU walls on a concrete foundation. The interior was partitioned with drywall walls. The floor was covered with floor tile and carpeting. At the time this Asbestos Survey was performed, the date of construction was not known.

SAMPLING METHODOLOGY

A visual inspection of the building was conducted to develop a sampling plan. This included determining sample collection points, homogeneous materials and areas. Friability was assessed by manually manipulating the suspect asbestos materials utilizing hand pressure to determine if the materials, when dry, can be crumbled, pulverized, or reduced to powder. Forty-three (43) homogeneous areas were established and at least three (3) samples were collected from each area. Areas that have suspect asbestos-containing surfacing, thermal systems insulation, or miscellaneous materials are to be considered homogeneous. These samples were each uniquely and individually identified and logged into a chain of custody document and prepared for shipment to a third-party independent laboratory for analysis. Building materials that are not considered suspect include the following; concrete, metal, glass, and wood. Destructive sampling was not authorized or performed to locate hidden or inaccessible materials.

SAMPLE ANALYSIS

One-hundred-twenty-nine (129) samples were submitted for analysis. Bulk PLM analysis was conducted utilizing the EPA Method 600/R-93/116. This method separates the sample material into various layers based on their morphology, and then the presence of the different asbestos fibers in each of these layers is detected. The analysis was performed by Apex Precision Analytical Services, Inc. located in Friendswood, TX. The term asbestos-containing material (ACM) is defined as a material that contains greater than 1% of any asbestiform varieties of Chrysotile, Amosite, Crocidolite, Tremolite, Anthophyllite, and Actinolite, or combinations of these materials. Asbestos materials were determined by the July 1993 Environmental Protection Agency as recommended in document EPA/600/R-93/116 titled, "Method for the Determination

of Asbestos in Bulk Building Materials." Copies of the asbestos laboratory results and related documentation have been attached to this Report.

CONCLUSION

No Asbestos-containing materials were identified as part of this Limited Asbestos Survey. No further assessment is recommended at this time. If, during the course of any remodeling or demolition activities suspect materials are found, additional sampling and analysis may be required.

Contact the Asbestos Inspector listed below with any clarifications that may be needed.

Inspected by:

David Morales
Asbestos Inspector
License # 60-2735

Reviewed by:

Tim Jones
Asbestos Consultant
License # 10-5575

Roof Samples
01-03

ENCON International, Inc.

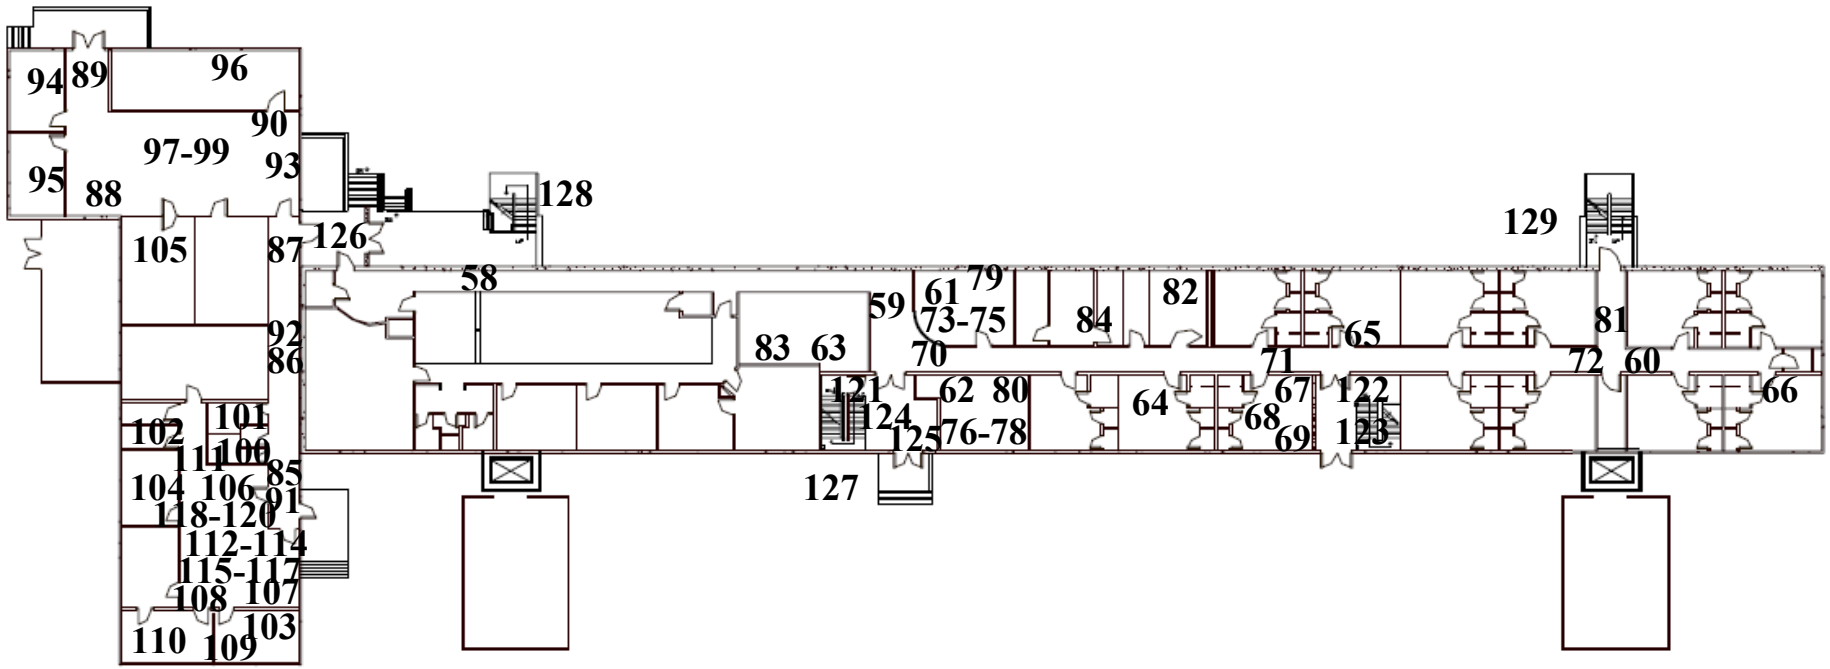

Asbestos Sample Locations ENCON #: 103-08-094 Date: 6/27/2008	# = Asbestos Sample Location # = Positive Asbestos Sample Location	Bldg. 2417 – 1st floor Asbestos Sample Location Drawing	N.T.S

ENCON International, Inc.

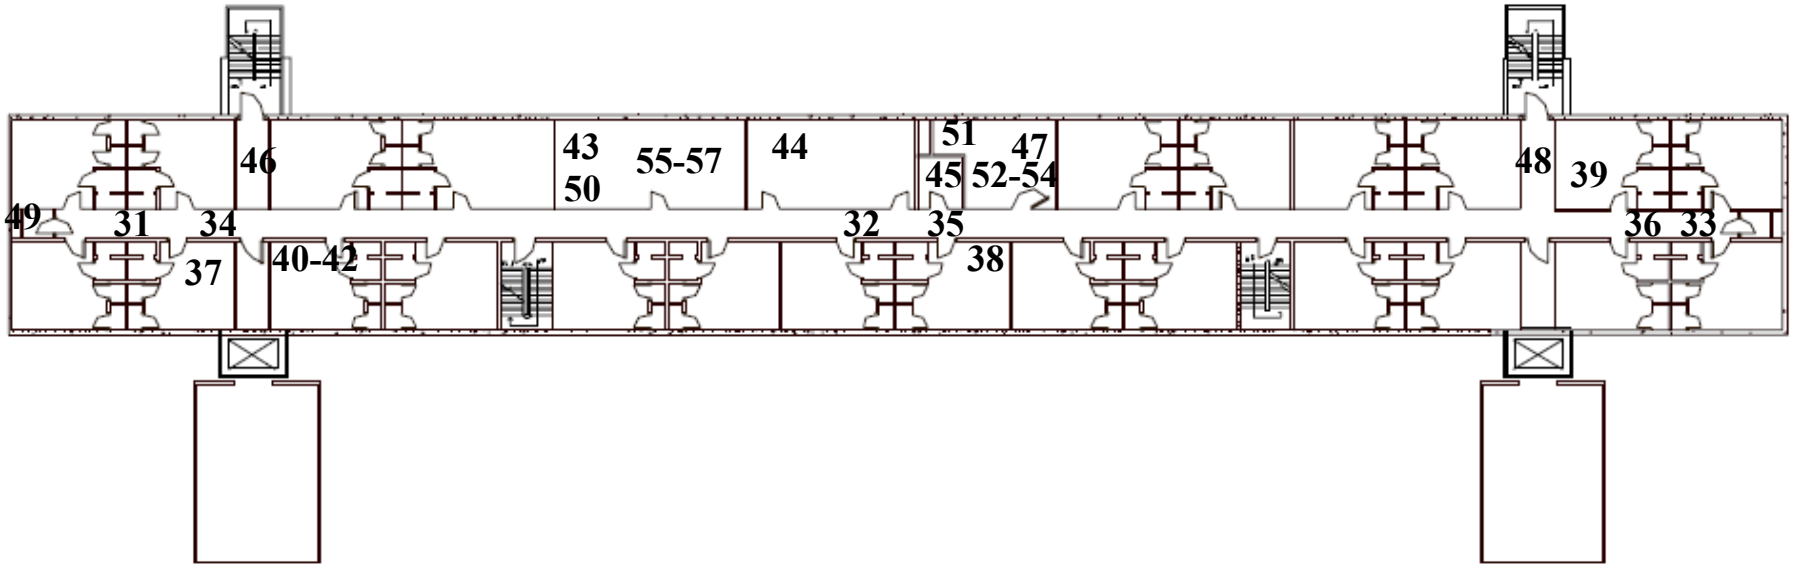

Asbestos Sample Locations ENCON #: 103-08-094 Date: 6/27/2008	# = Asbestos Sample Location [#] = Positive Asbestos Sample Location	Bldg. 2417 – 2nd floor Asbestos Sample Location Drawing	N.T.S

ENCON International, Inc.

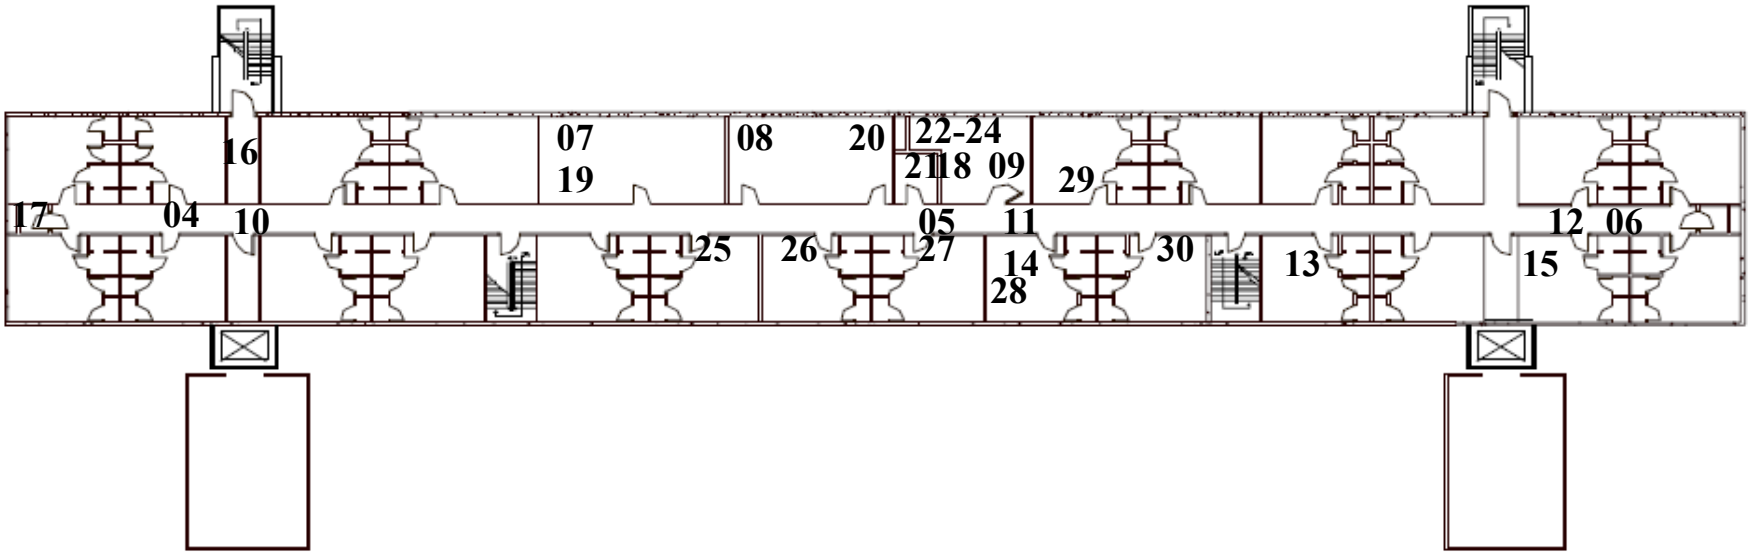

Asbestos Sample Locations ENCON #: 103-08-094 Date: 6/27/2008	# = Asbestos Sample Location # = Positive Asbestos Sample Location	Bldg. 2417 – 3rd floor Asbestos Sample Location Drawing	N.T.S

ENCON International, Inc.

No Access to Basement

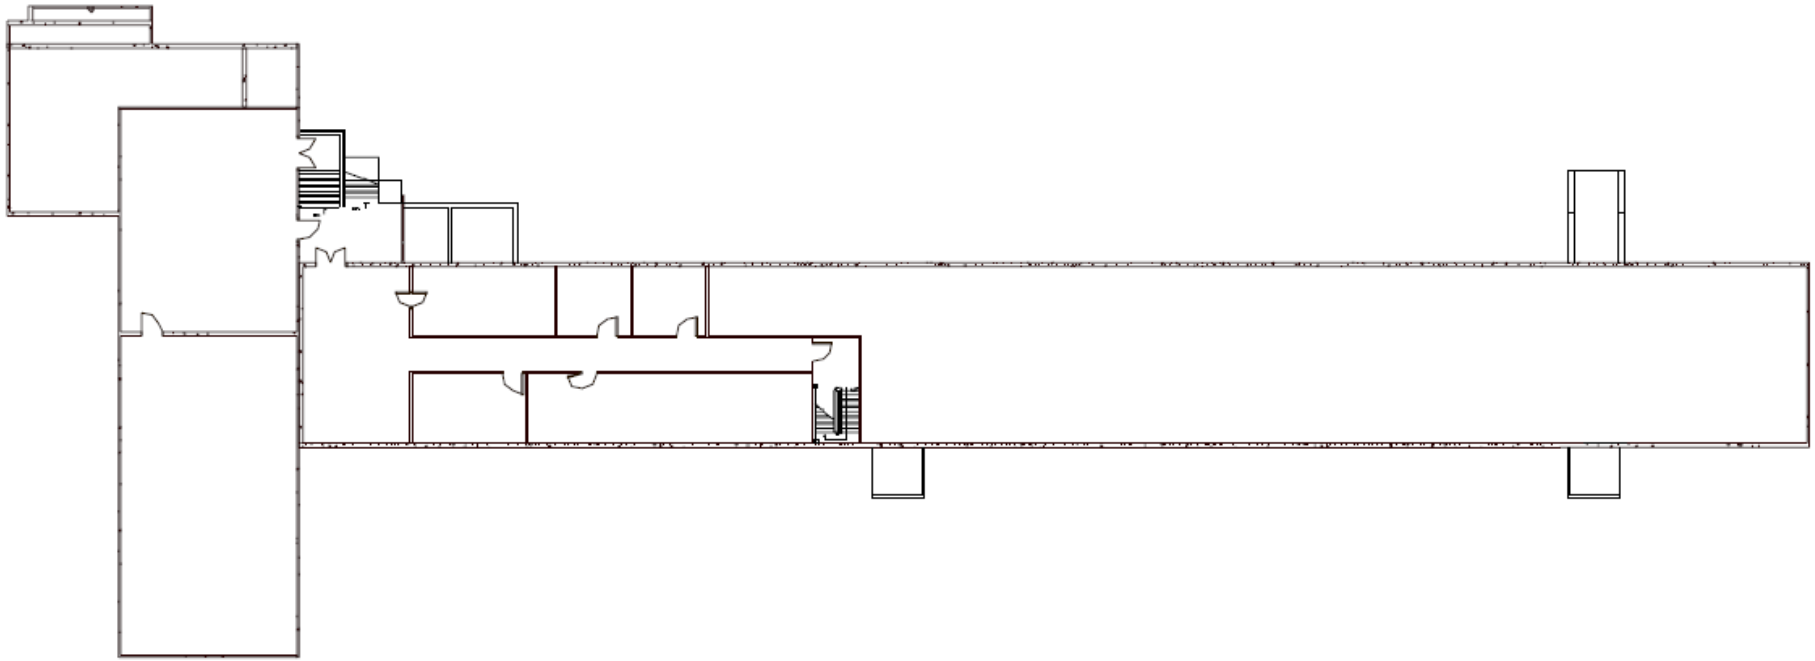

Asbestos Sample Locations **ENCON #: 103-08-094** **Date: 6/27/2008**	**# = Asbestos Sample Location** **# = Positive Asbestos Sample Location**	**Bldg. 2417 – basement** **Asbestos Sample Location Drawing**	**N.T.S**

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1618
Report Date: June 26, 2008
Samples Collected: June 24, 2008
Date Received: June 25, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Bldg. 2417

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-01	5008-1618-01	Light Gray,Black / Material / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-02	5008-1618-02	White,Yellow / Material / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-03	5008-1618-03A	White,Yellow / Material / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-03B	Light Grey / Material / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-04	5008-1618-04	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-05	5008-1618-05	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-06	5008-1618-06	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-07	5008-1618-07A	Tan / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-07B	Black / Mastic / Fibrous / Homogeneous	Chrysotile <1%	Cellulose 3%	Binder
S-08	5008-1618-08A	Tan / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM

TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1618
Report Date: June 26, 2008
Samples Collected: June 24, 2008
Date Received: June 25, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Bldg. 2417

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-08	5008-1618-08B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-09	5008-1618-09A	Tan / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-09B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-10	5008-1618-10	Beige / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-11	5008-1618-11	Beige / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-12	5008-1618-12	Beige / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-13	5008-1618-13	Yellow / Carpet Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-14	5008-1618-14	Yellow / Carpet Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-15	5008-1618-15	Yellow / Carpet Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-16	5008-1618-16A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM

TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1618
Report Date: June 26, 2008
Samples Collected: June 24, 2008
Date Received: June 25, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Bldg. 2417

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-16	5008-1618-16B	Off White / Joint Tape / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder
	5008-1618-16C	Green,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-17	5008-1618-17A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-17B	Off White / Joint Tape / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder
	5008-1618-17C	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-18	5008-1618-18A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-18B	Off White / Joint Tape / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder
	5008-1618-18C	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-19	5008-1618-19A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-19B	Off White / Joint Tape / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM
TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1618
Report Date: June 26, 2008
Samples Collected: June 24, 2008
Date Received: June 25, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Bldg. 2417

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-19	5008-1618-19C	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-20	5008-1618-20A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-20B	Off White / Joint Tape / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder
	5008-1618-20C	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-21	5008-1618-21A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-21B	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-22	5008-1618-22	White / Caulking / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-23	5008-1618-23	White / Caulking / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-24	5008-1618-24	White / Caulking / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-25	5008-1618-25A	Blue,Green / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM
TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1618
Report Date: June 26, 2008
Samples Collected: June 24, 2008
Date Received: June 25, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Bldg. 2417

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-25	5008-1618-25B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-26	5008-1618-26A	Blue,Green / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-26B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-27	5008-1618-27A	Blue,Green / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-27B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-28	5008-1618-28A	Off White / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-28B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-29	5008-1618-29A	Off White / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-29B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-30	5008-1618-30A	Off White / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM
TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1618
Report Date: June 26, 2008
Samples Collected: June 24, 2008
Date Received: June 25, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Bldg. 2417

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-30	5008-1618-30B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-31	5008-1618-31	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-32	5008-1618-32	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-33	5008-1618-33	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-34	5008-1618-34	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-35	5008-1618-35	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-36	5008-1618-36	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-37	5008-1618-37A	Off White / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-37B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-38	5008-1618-38A	Off White / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM

TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1618
Report Date: June 26, 2008
Samples Collected: June 24, 2008
Date Received: June 25, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Bldg. 2417

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-38	5008-1618-38B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-39	5008-1618-39A	Off White / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-39B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-40	5008-1618-40A	Grey / Material / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-40B	Tan / Carpet Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-41	5008-1618-41A	Grey / Material / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-41B	Tan / Carpet Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-42	5008-1618-42A	Grey / Material / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-42B	Tan / Carpet Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-43	5008-1618-43A	Tan / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM

TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1618
Report Date: June 26, 2008
Samples Collected: June 24, 2008
Date Received: June 25, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Bldg. 2417

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-43	5008-1618-43B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-44	5008-1618-44A	Tan / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-44B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-45	5008-1618-45A	Tan / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-45B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-46	5008-1618-46A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-46B	Off White / Joint Tape / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder
	5008-1618-46C	Green,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-47	5008-1618-47A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-47B	Off White / Joint Tape / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM

TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1618
Report Date: June 26, 2008
Samples Collected: June 24, 2008
Date Received: June 25, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Bldg. 2417

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-47	5008-1618-47C	Green,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-48	5008-1618-48A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-48B	Off White / Joint Tape / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder
	5008-1618-48C	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-49	5008-1618-49A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-49B	Off White / Joint Tape / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder
	5008-1618-49C	Green,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-50	5008-1618-50A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-50B	Off White / Joint Tape / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder
	5008-1618-50C	Green,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM
TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1618
Report Date: June 26, 2008
Samples Collected: June 24, 2008
Date Received: June 25, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Bldg. 2417

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-51	5008-1618-51A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-51B	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% 2%	Binder
S-52	5008-1618-52	White / Caulking / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-53	5008-1618-53	White / Caulking / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-54	5008-1618-54	White / Caulking / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-55	5008-1618-55	White / Ceiling Texture / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-56	5008-1618-56	White / Ceiling Texture / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-57	5008-1618-57	White / Ceiling Texture / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-58	5008-1618-58	Beige / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-59	5008-1618-59	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM
TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1618
Report Date: June 26, 2008
Samples Collected: June 24, 2008
Date Received: June 25, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Bldg. 2417

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-60	5008-1618-60	Beige / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-61	5008-1618-61A	Tan / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-61B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-62	5008-1618-62A	Tan / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-62B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-63	5008-1618-63A	Tan / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-63B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-64	5008-1618-64A	Green / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-64B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-65	5008-1618-65A	Green / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM

TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1618
Report Date: June 26, 2008
Samples Collected: June 24, 2008
Date Received: June 25, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Bldg. 2417

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-65	5008-1618-65B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-66	5008-1618-66A	Green / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-66B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-67	5008-1618-67A	Yellow / Carpet Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-67B	White / Leveling Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-67C	Black / Mastic / Fibrous / Homogeneous	None Detected	Cellulose <1%	Binder
S-68	5008-1618-68A	Yellow / Carpet Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-68B	White / Leveling Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-68C	Black / Mastic / Fibrous / Homogeneous	None Detected	Cellulose <1%	Binder
S-69	5008-1618-69A	Yellow / Carpet Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM
TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1618
Report Date: June 26, 2008
Samples Collected: June 24, 2008
Date Received: June 25, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Bldg. 2417

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-69	5008-1618-69B	White / Leveling Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-69C	Black / Mastic / Fibrous / Homogeneous	None Detected	Cellulose <1%	Binder
S-70	5008-1618-70	Beige / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-71	5008-1618-71	Beige / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-72	5008-1618-72	Beige / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-73	5008-1618-73	White,Grey / 2x4 Ceiling Tile / Fibrous / Homogeneous	None Detected	Cellulose 40% Fibrous Glass 10%	Binder
S-74	5008-1618-74	White,Grey / 2x4 Ceiling Tile / Fibrous / Homogeneous	None Detected	Cellulose 40% Fibrous Glass 10%	Binder
S-75	5008-1618-75	White,Grey / 2x4 Ceiling Tile / Fibrous / Homogeneous	None Detected	Cellulose 40% Fibrous Glass 10%	Binder
S-76	5008-1618-76	White / Caulking / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-77	5008-1618-77	White / Caulking / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM

TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1618
Report Date: June 26, 2008
Samples Collected: June 24, 2008
Date Received: June 25, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Bldg. 2417

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-78	5008-1618-78	White / Caulking / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-79	5008-1618-79A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-79B	Off White / Joint Tape / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder
	5008-1618-79C	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-80	5008-1618-80A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-80B	Off White / Joint Tape / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder
S-81	5008-1618-81A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-81B	Off White / Joint Tape / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder
	5008-1618-81C	Green,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-82	5008-1618-82A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM
TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1618
Report Date: June 26, 2008
Samples Collected: June 24, 2008
Date Received: June 25, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Bldg. 2417

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-82	5008-1618-82B	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-83	5008-1618-83A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-83B	Off White / Joint Tape / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder
S-84	5008-1618-84A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-84B	Green,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-85	5008-1618-85	Beige / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-86	5008-1618-86	Beige / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-87	5008-1618-87	Beige / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-88	5008-1618-88A	Light Pink / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-88B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM

TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1618
Report Date: June 26, 2008
Samples Collected: June 24, 2008
Date Received: June 25, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Bldg. 2417

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-89	5008-1618-89A	Light Pink / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-89B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-90	5008-1618-90A	Light Pink / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-90B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-91	5008-1618-91	Beige / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-92	5008-1618-92	Beige / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-93	5008-1618-93	Beige / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-94	5008-1618-94	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-95	5008-1618-95	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-96	5008-1618-96	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM

TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1618
Report Date: June 26, 2008
Samples Collected: June 24, 2008
Date Received: June 25, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Bldg. 2417

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-97	5008-1618-97	White,Grey / 2x4 Ceiling Tile / Fibrous / Homogeneous	None Detected	Cellulose 40% Fibrous Glass 10%	Binder
S-98	5008-1618-98	White,Grey / 2x4 Ceiling Tile / Fibrous / Homogeneous	None Detected	Cellulose 40% Fibrous Glass 10%	Binder
S-99	5008-1618-99	White,Grey / 2x4 Ceiling Tile / Fibrous / Homogeneous	None Detected	Cellulose 40% Fibrous Glass 10%	Binder
S-100	5008-1618-100A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-100B	Green,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-101	5008-1618-101A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-101B	Off White / Joint Tape / NonFibrous / Homogeneous	None Detected	Cellulose 95%	Binder
S-102	5008-1618-102A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-102B	Off White / Joint Tape / NonFibrous / Homogeneous	None Detected	Cellulose 95%	Binder
S-103	5008-1618-103A	White / Wall Covering / Fibrous / Homogeneous	None Detected	Cellulose 30%	Binder

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM
TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1618
Report Date: June 26, 2008
Samples Collected: June 24, 2008
Date Received: June 25, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Bldg. 2417

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-103	5008-1618-103B	Tan,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-104	5008-1618-104A	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-104B	Green,White / Drywall / Fibrous / Homogeneous	None Detected	Cellulose 10% Fibrous Glass 2%	Binder
S-105	5008-1618-105A	White / Wall Covering / Fibrous / Homogeneous	None Detected	Cellulose 95%	Binder
	5008-1618-105B	White / Texture,Joint Compound / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-106	5008-1618-106A	Light Pink / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-106B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-107	5008-1618-107A	Light Pink / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-107B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-108	5008-1618-108A	Light Pink / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM
TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1618
Report Date: June 26, 2008
Samples Collected: June 24, 2008
Date Received: June 25, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Bldg. 2417

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-108	5008-1618-108B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-109	5008-1618-109	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-110	5008-1618-110	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-111	5008-1618-111	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-112	5008-1618-112A	Black / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-112B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-113	5008-1618-113A	Black / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-113B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-114	5008-1618-114A	Black / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-114B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM

TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1618
Report Date: June 26, 2008
Samples Collected: June 24, 2008
Date Received: June 25, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Bldg. 2417

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-115	5008-1618-115A	Tan / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-115B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-116	5008-1618-116A	Tan / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-116B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-117	5008-1618-117A	Tan / 12 x 12 Floor Tile / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-117B	Yellow / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-118	5008-1618-118	White / Ceiling Texture / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-119	5008-1618-119	White / Ceiling Texture / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-120	5008-1618-120	White / Ceiling Texture / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-121	5008-1618-121	Beige / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM

TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

APEX PRECISION ANALYTICAL SERVICES, INC.

PLM (Bulk) - Asbestos Analysis Report - Visual ID
(EPA Method 600/R-93-116 Visual Area Estimation)

Client:
ENCON International
7307 Remcon Circle, Suite 100
El Paso, TX 79912
915-833-3740
Contact: David Morales

Report Number: 5008-1618
Report Date: June 26, 2008
Samples Collected: June 24, 2008
Date Received: June 25, 2008
Turn-around time: 24 Hours

Job ID / Site: 103-08-094 / Fort Bliss, Bldg. 2417

Client Sample Number	Lab Sample Number (by layer)	Color / Description / Fibrous / NonFibrous / Homogeneity	Asbestos Content Type & %	Non-Asbestos Fibrous Type & %	Matrix
S-122	5008-1618-122	Beige / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-123	5008-1618-123	Beige / Mastic / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-124	5008-1618-124	Beige,Yellow / Stucco / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-125	5008-1618-125	Beige,Yellow / Stucco / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-126	5008-1618-126	Beige,Yellow / Stucco / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-127	5008-1618-127	Yellow / Stucco / NonFibrous / Homogeneous	None Detected	None Detected	Binder
S-128	5008-1618-128A	Yellow / Stucco / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-128B	Grey / Material / Fibrous / Homogeneous	None Detected	Fibrous Glass 10%	Binder
S-129	5008-1618-129A	Yellow / Stucco / NonFibrous / Homogeneous	None Detected	None Detected	Binder
	5008-1618-129B	Grey / Material / Fibrous / Homogeneous	None Detected	Fibrous Glass 10%	Binder

Analytical results and reports are generated by Apex Precision Analytical Services at the request of and for the exclusive use of the person or entity (client) named on such report. Result, reports or copies of same will not be released by Apex Precision Analytical Services to any third party without the written request from client. These results only repesent the materials submitted. Supporting laboratory documentation is available upon request. This report cannot be used to represent conditions at any other location, date or time and does not imply that this space is free from these or any other contaminants. No responsibility or liability is assumed for the manner in which these results are used or interpreted. This must not be used to claim product endorsement by NVLAP or any government agency of the United States. Apex Precision Analytical Services reserves the right to dispose of all samples after a period of thirty (30) days, according to all state and federal guidelines, unless otherwise specified.

NVLAP Lab Code: 200633-0 PLM

TDSHS Asbestos Lab License#: 30-0312 PLM/PCM

306 West Edgewood Drive, Suite D, Friendswood, TX 77546 Office (281)648-9918 Fax (281)648-9595

Chain of Custody

Dates Collected: June 24, 2008	**Date Sent: June 24, 2008**
Contact : David Morales	**Remarks:**
Company: ENCON International	**P.O. #:**
Address: 7307 Remcon Circle, Suite 100	
El Paso, TX 79912	**APASI#:** *(For APASI use only)*
Phone: (915) 833-3740	**Fax: (915) 581-2049**

Turn Around Time:
Urgent / ASAP: __ **Rush:** X 24 Hr __ 48 Hr **Routine:** __3 Day __5 Day

Project Name/Number: 103-08-094 (Ft. Bliss, building 2417)

Mycology(Mold) Spore Trap-Air Samples

____ **Fungal/Mold spore count** by Air-O-Cell, Cyclex (d), BioCell, or other spore trap cassette/device

Phase Contrast Microscopy(PCM)-Air Samples

____ **Fiber Concentration** by NIOSH Method 7400 Issue 2

Industrial Hygiene-Air & Bulk Samples

____ **(RCF) Refractory Ceramic Fiber (Bulk) Identification** (Visual Estimation) by Polarized Light Microscopy

Mycology(Mold) Bulk ID Samples

____ **Fungal/Mold Identification** – bulk sample, tape lift, swab

Polarized Light Microscopy(PLM)-Bulk Samples

X **Asbestos Identification** (Visual Estimation) by EPA 600/R-93/116 Method
____ **Asbestos Identification** (Point Count) by EPA 600/M4-82-020 Method
____ **Asbestos Identification** (Soil/Prep) by Gravimetric Reduction

Sample #:	Location / Description:	Volume	Instructions
S-01	Roof penetration sealant		
S-02	Roof penetration sealant		
S-03	Roof penetration sealant		
S-04	Rubberized flooring mastic		
S-05	Rubberized flooring mastic		
S-06	Rubberized flooring mastic		
S-07	12” x 12 floor tile & mastic		
S-08	12” x 12 floor tile & mastic		
S-09	12” x 12 floor tile & mastic		
S-10	Cove base mastic		

Relinquished by:_____ **Received by:**_____

Date: 06/24/2008 **Time:** 1700 **Date:**_____ **Time:**_____

Sample #:	Location:	Volume	Instructions
S-11	Cove base mastic		
S-12	Cove base mastic		
S-13	Carpet mastic		
S-14	Carpet mastic		
S-15	Carpet mastic		
S-16	Textured drywall/joint compound		
S-17	Textured drywall/joint compound		
S-18	Textured drywall/joint compound		
S-19	Textured drywall/joint compound		
S-20	Textured drywall/joint compound		
S-21	Textured drywall/joint compound		
S-22	Caulking		
S-23	Caulking		
S-24	Caulking		
S-25	12” x 12 floor tile & mastic		
S-26	12” x 12 floor tile & mastic		
S-27	12” x 12 floor tile & mastic		
S-28	12” x 12 floor tile & mastic		
S-29	12” x 12 floor tile & mastic		
S-30	12” x 12 floor tile & mastic		
S-31	Rubberized flooring mastic		
S-32	Rubberized flooring mastic		
S-33	Rubberized flooring mastic		
S-34	Cove base mastic		
S-35	Cove base mastic		
S-36	Cove base mastic		
S-37	12” x 12 floor tile & mastic		
S-38	12” x 12 floor tile & mastic		
S-39	12” x 12 floor tile & mastic		
S-40	Carpet mastic		
S-41	Carpet mastic		
S-42	Carpet mastic		
S-43	12” x 12 floor tile & mastic		
S-44	12” x 12 floor tile & mastic		
S-45	12” x 12 floor tile & mastic		

Sample #:	Location:	Volume	Instructions
S-46	Textured drywall/joint compound		
S-47	Textured drywall/joint compound		
S-48	Textured drywall/joint compound		
S-49	Textured drywall/joint compound		
S-50	Textured drywall/joint compound		
S-51	Textured drywall/joint compound		
S-52	Caulking		
S-53	Caulking		
S-54	Caulking		
S-55	Popcorn ceiling texture		
S-56	Popcorn ceiling texture		
S-57	Popcorn ceiling texture		
S-58	Rubberized flooring mastic		
S-59	Rubberized flooring mastic		
S-60	Rubberized flooring mastic		
S-61	12” x 12 floor tile & mastic		
S-62	12” x 12 floor tile & mastic		
S-63	12” x 12 floor tile & mastic		
S-64	12” x 12 floor tile & mastic		
S-65	12” x 12 floor tile & mastic		
S-66	12” x 12 floor tile & mastic		
S-67	Carpet mastic		
S-68	Carpet mastic		
S-69	Carpet mastic		
S-70	Cove base mastic		
S-71	Cove base mastic		
S-72	Cove base mastic		
S-73	2’ x 4’ ceiling panels		
S-74	2’ x 4’ ceiling panels		
S-75	2’ x 4’ ceiling panels		
S-76	Caulking		
S-77	Caulking		
S-78	Caulking		
S-79	Textured drywall/joint compound		
S-80	Textured drywall/joint compound		

Sample #:	Location:	Volume	Instructions
S-81	Textured drywall/joint compound		
S-82	Textured drywall/joint compound		
S-83	Textured drywall/joint compound		
S-84	Textured drywall/joint compound		
S-85	Rubberized flooring mastic		
S-86	Rubberized flooring mastic		
S-87	Rubberized flooring mastic		
S-88	12” x 12 floor tile & mastic		
S-89	12” x 12 floor tile & mastic		
S-90	12” x 12 floor tile & mastic		
S-91	Cove base mastic		
S-92	Cove base mastic		
S-93	Cove base mastic		
S-94	Carpet mastic		
S-95	Carpet mastic		
S-96	Carpet mastic		
S-97	2’ x 4’ ceiling panels		
S-98	2’ x 4’ ceiling panels		
S-99	2’ x 4’ ceiling panels		
S-100	Textured drywall/joint compound		
S-101	Textured drywall/joint compound		
S-102	Textured drywall/joint compound		
S-103	Textured drywall/joint compound		
S-104	Textured drywall/joint compound		
S-105	Textured drywall/joint compound		
S-106	12” x 12 floor tile & mastic		
S-107	12” x 12 floor tile & mastic		
S-108	12” x 12 floor tile & mastic		
S-109	Cove base mastic		
S-110	Cove base mastic		
S-111	Cove base mastic		
S-112	12” x 12 floor tile & mastic		
S-113	12” x 12 floor tile & mastic		
S-114	12” x 12 floor tile & mastic		
S-115	12” x 12 floor tile & mastic		

Sample #:	Location:	Volume	Instructions
S-116	12” x 12 floor tile & mastic		
S-117	12” x 12 floor tile & mastic		
S-118	Popcorn ceiling texture		
S-119	Popcorn ceiling texture		
S-120	Popcorn ceiling texture		
S-121	Stair tread & landing mastic		
S-122	Stair tread & landing mastic		
S-123	Stair tread & landing mastic		
S-124	Stucco texture		
S-125	Stucco texture		
S-126	Stucco texture		
S-127	Stucco texture		
S-128	Stucco texture		
S-129	Stucco texture		

LEAD INSPECTION
BUILDING 2417
FORT BLISS, TEXAS 79916

Prepared for:
Mr. Henry Wilson, P.E.
DPW
Building 777
Fort Bliss, Texas 79916

Prepared by:
ENCON International, Inc.
7307 Remcon Circle,
Suite 103
El Paso, Texas 79912

Date of Inspection:
June 24, 2008

ENCON Project No. 103-08-094

ENCON INTERNATIONAL, INC.

Engineering, Environmental & Technical Services

June 27, 2008

Mr. Henry Wilson, PE
General Engineer
DPW-Building 777
Fort Bliss, TX 79916

Phone:(915)568-2300
Via email & hand delivery

RE: LEAD-BASED PAINT INSPECTION
Building 2417
Ft. Bliss, TX 79916

Dear Mr. Wilson:

ENCON International, Inc., (ENCON) has submitted for your review the attached Lead-Based Paint (LBP) Inspection conducted at Building 2417, Fort Bliss, Texas. This inspection was performed of the entire building to address the Occupational Safety and Health Administration (OSHA) lead regulations (29 CFR 1926.62).

This LBP Inspection was performed on June 24, 2008 by Mr. Tim Jones, certified Texas Department of State Health Services (DSHS) Lead Risk Assessor on utilizing a NITON XLp 303 AW X-Ray Fluorescence analyzer (XRF) with serial No. 18451.

We appreciate the opportunity to be of service to you. Please call if you have any questions or if we may be of further assistance.

Sincerely,

Alex Woelper, P.E.
Program Manager

Attachments:

- Lead Inspection Report
- Lead Drawings
- Technical Documentation

SUMMARY

ENCON International, Inc, (ENCON) presents the findings of the Lead-Based Paint (LBP) Inspection performed at Building 2417, Ft. Bliss, Texas 79916. The purpose of this LBP inspection was to determine if LBP was present in the areas scheduled for renovation, and if present, which building components contain LBP. This was determined by performing a surface-by-surface investigation of all painted components. This information is necessary in order for contractors to comply with OSHA regulation 29 CFR 1926.62 Safety and Health Regulations for Construction - Lead.

Lead-based Paint means paint or other surface coatings that contain lead equal to or in excess of 1.0 milligrams per square centimeter (mg/cm^2) or more than 0.5%, or 5000 parts per million by weight as established by EPA and HUD regulations. However, for the purposes of this study, ENCON will utilize the "Action Level" of the XRF at 0.3 milligrams per square centimeter (mg/cm^2), as the NITON XRF detectable limit. **Results indicate that twenty-four (24) of the one hundred twenty-one (121) XRF readings tested at or above the limit of 0.3 mg/cm^2.** The LBP Inspection was conducted by Mr. Tim Jones, a certified Lead Risk Assessor. Results are indicated on a separate drawing and XRF data sheet.

DESCRIPTION OF AREAS INSPECTED

Building 2417 was primarily being used as barracks, housing military personnel on Fort Bliss, Texas. There were also areas that were being used for storage and administrative offices. The building occupied approximately 38,087 SF. The building was a three-story structure with a basement constructed with CMU walls on a concrete foundation. The interior was partitioned with drywall walls. Most of the floor was covered with floor tile and carpeting, but some was painted concrete. At the time this Lead Inspection was performed, the date of construction was not known, but the building appeared to have been repainted over the years. An inventory of the affected painted surfaces was recorded as XRF testing proceeded. See the "LBP Testing Data Sheet."

CALIBRATION OF THE XRF INSTRUMENT

Before proceeding with the investigation of painted surfaces, the XRF was calibrated in accordance to the manufacturer's quality control procedures. The XRF utilized was a Niton XLp 303 AW X-Ray Fluorescence analyzer (XRF) with serial No. 18451. The inspector took three calibration readings at 1.0 mg/cm^2 and at the Action Level of 0.3 mg/cm^2 on a lead calibration film provided by the manufacturer. The measured difference between the initial calibration test and the lead film was within the manufacturer's acceptable calibration tolerance limit ($\leq$ 0.2 mg/cm^2). In accordance with the HUD XRF Performance Characteristic Sheet, the XRF instrument did not require correction for substrate bias for any substrate encountered and the instrument had no inconclusive range. Calibration of the instrument was also conducted at the conclusion of sampling for the building using the same procedures as the initial calibration check.

XRF READINGS THAT TESTED POSITIVE FOR LEAD (>0.3 mg/cm^2)

No	Component	Substrate	Condition	Color	Room	PbC
122	THRESHOLD	CONCRETE	FAIR	BROWN	PORCH	0.6
123	FLOOR	CONCRETE	FAIR	BROWN	PORCH	0.5
124	RISER	CONCRETE	FAIR	BROWN	PORCH	0.6
126	FLOOR	CONCRETE	POOR	YELLOW	OUTSIDE	0.4
128	STRINGER	CONCRETE	FAIR	TAN	OUTSIDE	0.7
134	WALL	CONCRETE	FAIR	TAN	OUTSIDE	0.7
135	COLUMN	CONCRETE	FAIR	TAN	OUTSIDE	0.7
138	COLUMN	CONCRETE	FAIR	TAN	STAIR	0.6
139	UNDERSIDE	CONCRETE	FAIR	TAN	STAIR	0.8
153	DOOR-INNER	METAL	FAIR	BROWN	MECH	9.2
154	DOOR-INNER	METAL	FAIR	GREY	MECH	8.2
155	WALL	CONCRETE	FAIR	WHITE	MECH	0.4
156	COLUMN	CONCRETE	FAIR	WHITE	MECH	0.4
157	CEILING	CONCRETE	FAIR	TAN	STAIR	0.9
159	CURB	CONCRETE	FAIR	TAN	STAIR	0.6
160	BUMPER	METAL	FAIR	BROWN	PORCH	0.5
164	COLUMN	CONCRETE	FAIR	TAN	OUTSIDE	0.9
168	DOOR	METAL	FAIR	BROWN	PORCH	0.5
171	WALL	CONCRETE	FAIR	TAN	CHILLER	0.5
172	WALL	CONCRETE	FAIR	TAN	STAIR	1.3
174	LADDER	METAL	FAIR	TAN	STAIR	10.5
183	CEILING	CONCRETE	FAIR	WHITE	STORAGE	0.6
198	WALL	CONCRETE	FAIR	BEIGE	STAIR	1.1
211	STRINGER	CONCRETE	FAIR	TAN	STAIR	0.4

Care shall also be taken for surfaces that contain levels of lead below the Action Level stated above for the instrument (0.3 mg/cm^2), which could create lead dust or lead-contaminated soil hazards if the paint is turned into dust by abrasion, scraping, or sanding.

SUMMARY

ENCON has performed a lead-based paint inspection at Building # 2417 Fort Bliss, Texas 79916. The attached drawing indicates the locations where samples were taken.

Inspected by:

Tim Jones
Lead Risk Assessor
DSHS # 2070306

Reviewed by:

David Morales
Lead Risk Assessor
DSHS # 2070809

ENCON International, Inc.

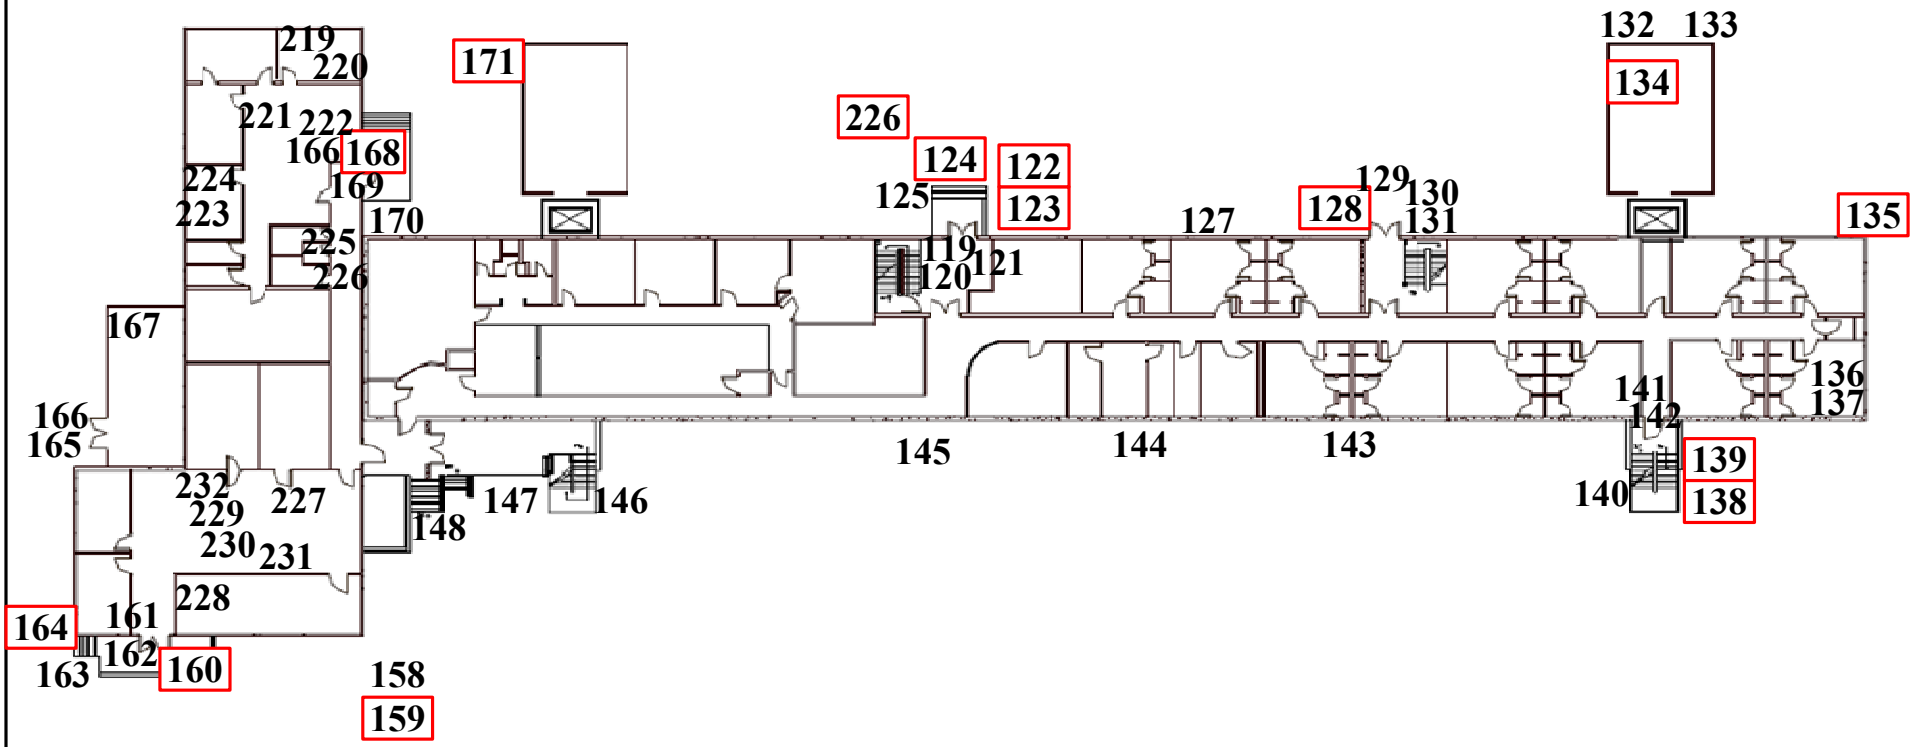

Lead Sample Locations ENCON #: 103-08-094 Date: 6/27/2008	# = Lead Sample Location [#] = Positive Lead Sample Location	Bldg. 2417 – 1st floor Lead Sample Location Drawing	N.T.S

ENCON International, Inc.

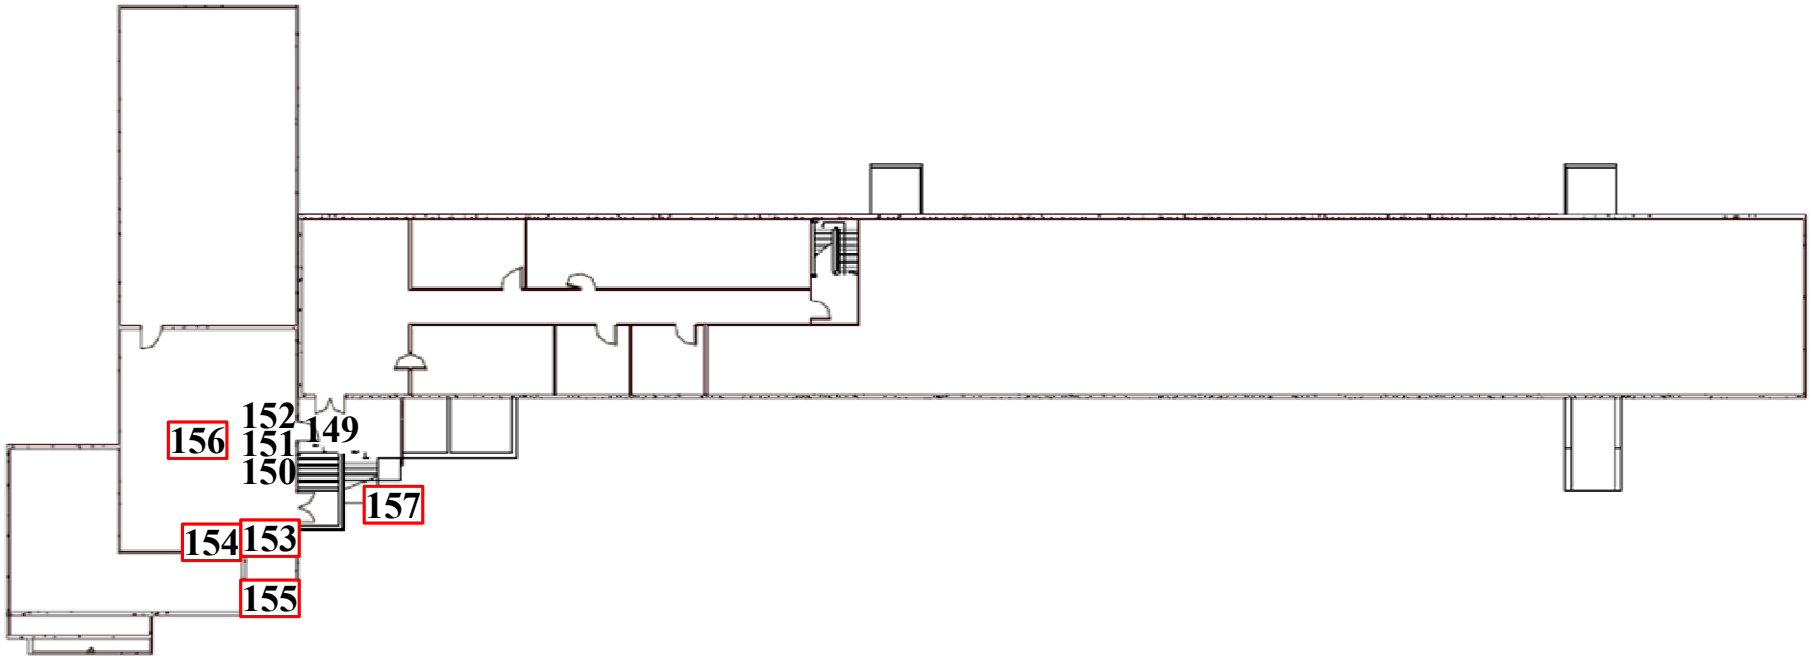

Lead Sample Locations ENCON #: 103-08-094 Date: 6/27/2008	# = Lead Sample Location [#] = Positive Lead Sample Location	Bldg. 2417 – basement Lead Sample Location Drawing	N.T.S

ENCON International, Inc.

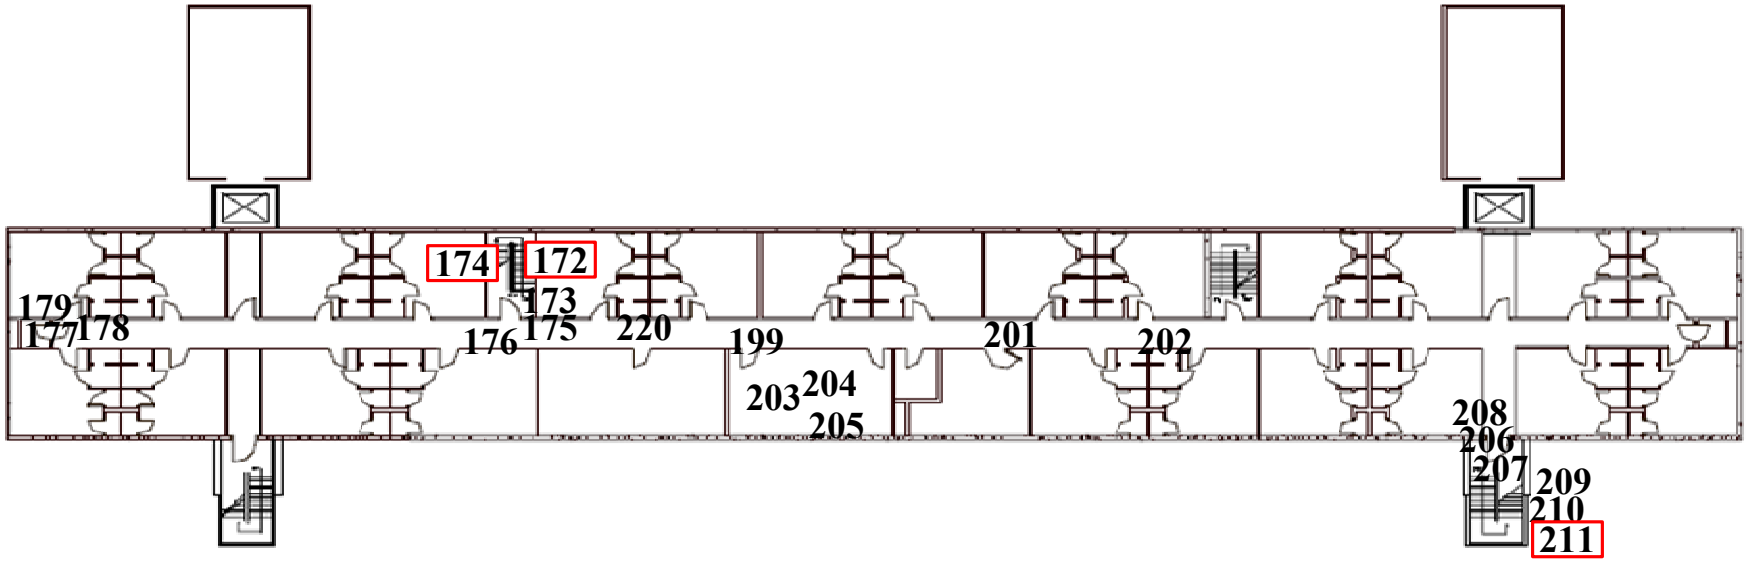

Lead Sample Locations ENCON #: 103-08-094 Date: 6/27/2008	# = Lead Sample Location # = Positive Lead Sample Location	Bldg. 2417 – 3rd floor Lead Sample Location Drawing	N.T.S

ENCON International, Inc.

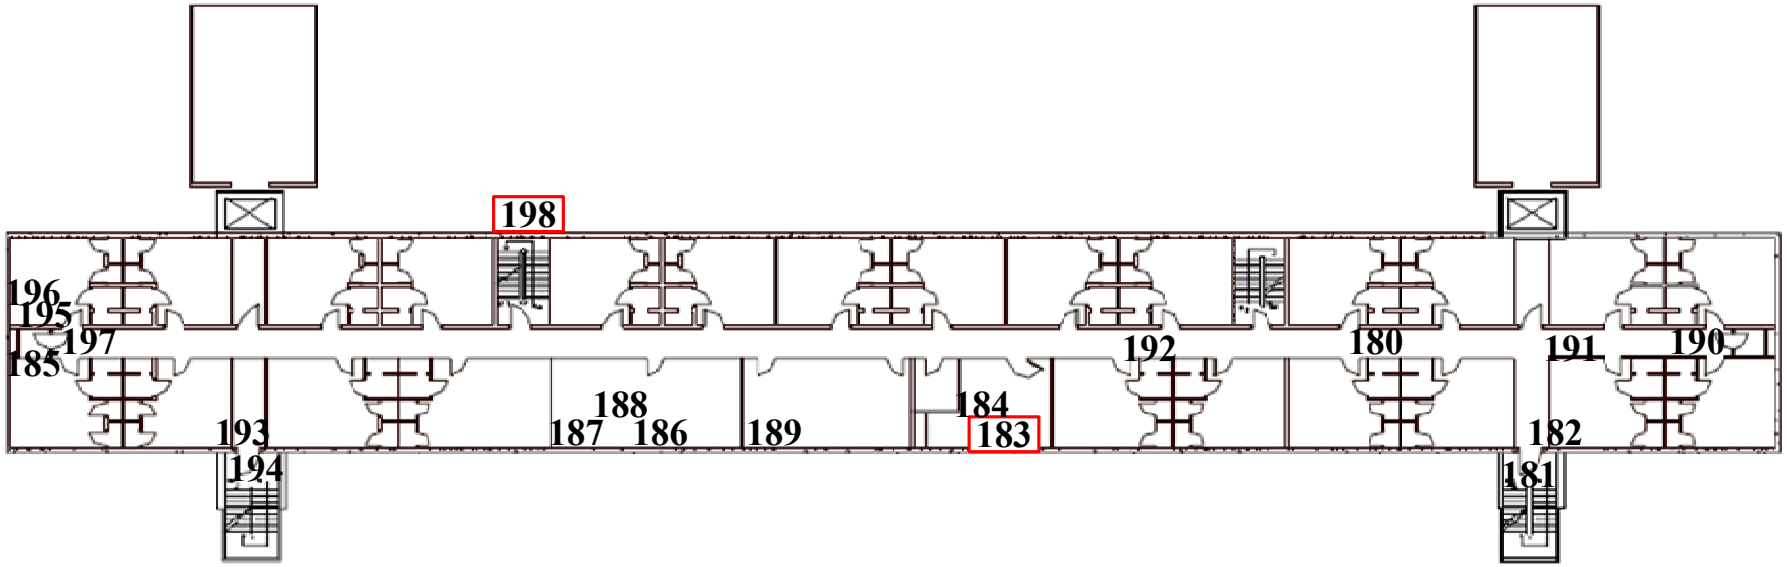

Lead Sample Locations ENCON #: 103-08-094 Date: 6/27/2008	# = Lead Sample Location [#] = Positive Lead Sample Location	Bldg. 2417 – 2nd floor Lead Sample Location Drawing	N.T.S

No	Type	Component	Substrate	Condition	Color	Site	Floor	Room	Misc 1	Results	Action Level	PbC
115	SHUTTER_CAL											10.35
116	**PAINT**		**CALIBRATE**							**Positive**	**0.3**	**1.2**
117	**PAINT**		**CALIBRATE**							**Positive**	**0.3**	**0.4**
118	**PAINT**		**CALIBRATE**							**Positive**	**0.3**	**0.3**
119	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2417	FIRST	PORCH		Negative	0.3	0
120	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2417	FIRST	PORCH	CASING	Null	0.3	0
121	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2417	FIRST	PORCH	CASING	Negative	0.3	0
122	**PAINT**	**THRESHOLD**	**CONCRETE**	**FAIR**	**BROWN**	**BLDG 2417**	**FIRST**	**PORCH**		**Positive**	**0.3**	**0.6**
123	**PAINT**	**FLOOR**	**CONCRETE**	**FAIR**	**BROWN**	**BLDG 2417**	**FIRST**	**PORCH**		**Positive**	**0.3**	**0.5**
124	**PAINT**	**RISER**	**CONCRETE**	**FAIR**	**BROWN**	**BLDG 2417**	**FIRST**	**PORCH**		**Positive**	**0.3**	**0.6**
125	PAINT	RAIL	CONCRETE	FAIR	BROWN	BLDG 2417	FIRST	PORCH		Negative	0.3	0
126	**PAINT**	**FLOOR**	**CONCRETE**	**POOR**	**YELLOW**	**BLDG 2417**	**FIRST**	**OUTSIDE**		**Positive**	**0.3**	**0.4**
127	PAINT	WALL	STUCCO	FAIR	TAN	BLDG 2417	FIRST	OUTSIDE		Negative	0.3	0
128	**PAINT**	**STRINGER**	**CONCRETE**	**FAIR**	**TAN**	**BLDG 2417**	**FIRST**	**OUTSIDE**		**Positive**	**0.3**	**0.7**
129	PAINT	RAIL	METAL	FAIR	BLACK	BLDG 2417	FIRST	OUTSIDE		Negative	0.3	0.01
130	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2417	FIRST	PORCH		Negative	0.3	0
131	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2417	FIRST	PORCH	CASING	Negative	0.3	0
132	PAINT	DOOR	METAL	FAIR	TAN	BLDG 2417	FIRST	OUTSIDE	CASING	Negative	0.3	0
133	PAINT	DOOR	METAL	POOR	TAN	BLDG 2417	FIRST	OUTSIDE		Negative	0.3	0
134	**PAINT**	**WALL**	**CONCRETE**	**FAIR**	**TAN**	**BLDG 2417**	**FIRST**	**OUTSIDE**		**Positive**	**0.3**	**0.7**
135	**PAINT**	**COLUMN**	**CONCRETE**	**FAIR**	**TAN**	**BLDG 2417**	**FIRST**	**OUTSIDE**		**Positive**	**0.3**	**0.7**
136	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2417	FIRST	OUTSIDE	ACCESS	Negative	0.3	0
137	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2417	FIRST	OUTSIDE	CASING	Negative	0.3	0
138	**PAINT**	**COLUMN**	**CONCRETE**	**FAIR**	**TAN**	**BLDG 2417**	**FIRST**	**STAIR**		**Positive**	**0.3**	**0.6**
139	**PAINT**	**UNDERSIDE**	**CONCRETE**	**FAIR**	**TAN**	**BLDG 2417**	**FIRST**	**STAIR**		**Positive**	**0.3**	**0.8**
140	PAINT	RAIL	CONCRETE	FAIR	TAN	BLDG 2417	FIRST	STAIR		Negative	0.3	0.01
141	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2417	FIRST	PORCH		Negative	0.3	0
142	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2417	FIRST	PORCH	CASING	Negative	0.3	0
143	PAINT	WALL	STUCCO	FAIR	TAN	BLDG 2417	FIRST	PORCH	CASING	Negative	0.3	0
144	PAINT	WALL	STUCCO	FAIR	GREEN	BLDG 2417	FIRST	PORCH	CASING	Negative	0.3	0
145	PAINT	WINDOW	STUCCO	FAIR	TAN	BLDG 2417	FIRST	OUTSIDE	CASING	Negative	0.3	0
146	PAINT	RAIL	METAL	FAIR	BROWN	BLDG 2417	FIRST	OUTSIDE		Negative	0.3	0
147	PAINT	RAIL	METAL	FAIR	BROWN	BLDG 2417	FIRST	PORCH		Negative	0.3	0
148	PAINT	RAIL	METAL	FAIR	BROWN	BLDG 2417	BASEMENT	OUTSIDE		Negative	0.3	0.01
149	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2417	BASEMENT	OUTSIDE	CASING	Null	0.3	0
150	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2417	BASEMENT	OUTSIDE		Negative	0.3	0
151	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2417	BASEMENT	MECH		Negative	0.3	0
152	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2417	BASEMENT	MECH	CASING	Negative	0.3	0
153	**PAINT**	**DOOR-INNER**	**METAL**	**FAIR**	**BROWN**	**BLDG 2417**	**BASEMENT**	**MECH**	**CASING**	**Positive**	**0.3**	**9.2**
154	**PAINT**	**DOOR-INNER**	**METAL**	**FAIR**	**GREY**	**BLDG 2417**	**BASEMENT**	**MECH**	**CASING**	**Positive**	**0.3**	**8.2**
155	**PAINT**	**WALL**	**CONCRETE**	**FAIR**	**WHITE**	**BLDG 2417**	**BASEMENT**	**MECH**		**Positive**	**0.3**	**0.4**
156	**PAINT**	**COLUMN**	**CONCRETE**	**FAIR**	**WHITE**	**BLDG 2417**	**BASEMENT**	**MECH**		**Positive**	**0.3**	**0.4**

No	Type	Component	Substrate	Condition	Color	Site	Floor	Room	Misc 1	Results	Action Level	PbC
157	**PAINT**	**CEILING**	**CONCRETE**	**FAIR**	**TAN**	**BLDG 2417**	**BASEMENT**	**STAIR**		**Positive**	**0.3**	**0.9**
158	PAINT	CURB	CONCRETE	FAIR	TAN	BLDG 2417	FIRST	OUTSIDE		Null	0.3	0.02
159	**PAINT**	**CURB**	**CONCRETE**	**FAIR**	**TAN**	**BLDG 2417**	**FIRST**	**OUTSIDE**		**Positive**	**0.3**	**0.6**
160	**PAINT**	**BUMPER**	**METAL**	**FAIR**	**BROWN**	**BLDG 2417**	**FIRST**	**PORCH**		**Positive**	**0.3**	**0.5**
161	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2417	FIRST	PORCH		Negative	0.3	0
162	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2417	FIRST	PORCH	CASING	Negative	0.3	0
163	PAINT	RAIL	METAL	FAIR	BROWN	BLDG 2417	FIRST	PORCH		Negative	0.3	0
164	**PAINT**	**COLUMN**	**CONCRETE**	**FAIR**	**TAN**	**BLDG 2417**	**FIRST**	**OUTSIDE**		**Positive**	**0.3**	**0.9**
165	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2417	FIRST	CHILLER		Negative	0.3	0
166	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2417	FIRST	CHILLER		Negative	0.3	0
167	PAINT	RAIL	METAL	FAIR	TAN	BLDG 2417	FIRST	CHILLER		Negative	0.3	0
168	**PAINT**	**DOOR**	**METAL**	**FAIR**	**BROWN**	**BLDG 2417**	**FIRST**	**PORCH**	**CASING**	**Positive**	**0.3**	**0.5**
169	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2417	FIRST	PORCH		Negative	0.3	0
170	PAINT	RAIL	METAL	FAIR	BLACK	BLDG 2417	FIRST	PORCH		Negative	0.3	0
171	**PAINT**	**WALL**	**CONCRETE**	**FAIR**	**TAN**	**BLDG 2417**	**FIRST**	**CHILLER**		**Positive**	**0.3**	**0.5**
172	**PAINT**	**WALL**	**CONCRETE**	**FAIR**	**TAN**	**BLDG 2417**	**THIRD**	**STAIR**		**Positive**	**0.3**	**1.3**
173	PAINT	RAIL	METAL	FAIR	BLACK	BLDG 2417	THIRD	STAIR		Negative	0.3	0
174	**PAINT**	**LADDER**	**METAL**	**FAIR**	**TAN**	**BLDG 2417**	**THIRD**	**STAIR**		**Positive**	**0.3**	**10.5**
175	PAINT	DOOR	METAL	FAIR	PINK	BLDG 2417	THIRD	STAIR		Negative	0.3	0
176	PAINT	DOOR	METAL	FAIR	PINK	BLDG 2417	THIRD	STAIR	CASING	Negative	0.3	0
177	PAINT	DOOR	METAL	FAIR	PINK	BLDG 2417	THIRD	STAIR	CASING	Negative	0.3	0
178	PAINT	WALL	DRYWALL	FAIR	TAN	BLDG 2417	THIRD	JAN		Negative	0.3	0
179	PAINT	CEILING	DRYWALL	FAIR	TAN	BLDG 2417	THIRD	JAN		Negative	0.3	0
180	PAINT	CEILING	DRYWALL	FAIR	TAN	BLDG 2417	THIRD	HALL		Negative	0.3	0
181	PAINT	DOOR	METAL	FAIR	PINK	BLDG 2417	SECOND	EXIT		Negative	0.3	0
182	PAINT	DOOR	METAL	FAIR	PINK	BLDG 2417	SECOND	EXIT	CASING	Negative	0.3	0
183	**PAINT**	**CEILING**	**CONCRETE**	**FAIR**	**WHITE**	**BLDG 2417**	SECOND	**STORAGE**		**Positive**	**0.3**	**0.6**
184	PAINT	WALL	DRYWALL	FAIR	TAN	BLDG 2417	SECOND	STORAGE		Negative	0.3	0
185	PAINT	WALL	DRYWALL	FAIR	TAN	BLDG 2417	SECOND	ELEC		Negative	0.3	0
186	PAINT	CEILING	DRYWALL	FAIR	TAN	BLDG 2417	SECOND	LAUNDRY		Negative	0.3	0.01
187	PAINT	WALL	DRYWALL	FAIR	TAN	BLDG 2417	SECOND	LAUNDRY		Negative	0.3	0
188	PAINT	WINDOW	WOOD	FAIR	WHITE	BLDG 2417	SECOND	LAUNDRY	STOOL	Negative	0.3	0
189	PAINT	WALL	DRYWALL	FAIR	WHITE	BLDG 2417	SECOND	STORAGE		Negative	0.3	0
190	PAINT	CEILING	DRYWALL	FAIR	WHITE	BLDG 2417	SECOND	JAN		Negative	0.3	0.01
191	PAINT	CEILING	DRYWALL	FAIR	WHITE	BLDG 2417	SECOND	HALL		Negative	0.3	0
192	PAINT	WALL	DRYWALL	FAIR	WHITE	BLDG 2417	SECOND	HALL		Negative	0.3	0
193	PAINT	DOOR	METAL	FAIR	PINK	BLDG 2417	SECOND	EXIT		Negative	0.3	0
194	PAINT	DOOR	METAL	FAIR	BROWN	BLDG 2417	SECOND	OUTSIDE	CASING	Negative	0.3	0
195	PAINT	WALL	DRYWALL	FAIR	TAN	BLDG 2417	SECOND	JAN		Negative	0.3	0
196	PAINT	CEILING	DRYWALL	FAIR	TAN	BLDG 2417	SECOND	JAN		Negative	0.3	0
197	PAINT	DOOR	METAL	FAIR	PINK	BLDG 2417	SECOND	JAN	CASING	Negative	0.3	0
198	**PAINT**	**WALL**	**CONCRETE**	**FAIR**	**BEIGE**	**BLDG 2417**	**SECOND**	**STAIR**		**Positive**	**0.3**	**1.1**

No	Type	Component	Substrate	Condition	Color	Site	Floor	Room	Misc 1	Results	Action Level	PbC
199	PAINT	WALL	DRYWALL	FAIR	BEIGE	BLDG 2417	THIRD	HALL		Negative	0.3	0
200	PAINT	CEILING	DRYWALL	FAIR	BEIGE	BLDG 2417	THIRD	HALL		Negative	0.3	0
201	PAINT	DOOR	METAL	FAIR	PINK	BLDG 2417	THIRD	HALL		Negative	0.3	0
202	PAINT	DOOR	METAL	FAIR	PINK	BLDG 2417	THIRD	HALL	CASING	Negative	0.3	0
203	PAINT	WALL	DRYWALL	FAIR	TAN	BLDG 2417	THIRD	LAUNDRY		Null	0.3	0
204	PAINT	WINDOW	WOOD	FAIR	WHITE	BLDG 2417	THIRD	LAUNDRY	STOOL	Negative	0.3	0
205	PAINT	DOOR	METAL	FAIR	PINK	BLDG 2417	THIRD	LAUNDRY	CASING	Negative	0.3	0
206	PAINT	DOOR	METAL	FAIR	PINK	BLDG 2417	THIRD	STAIR	CASING	Negative	0.3	0
207	PAINT	CEILING	DRYWALL	FAIR	WHITE	BLDG 2417	THIRD	HALL		Negative	0.3	0
208	PAINT	RAIL	METAL	FAIR	BLACK	BLDG 2417	THIRD	STAIR		Null	0.3	0
209	PAINT	RAIL	METAL	FAIR	BLACK	BLDG 2417	THIRD	STAIR		Negative	0.3	0
210	PAINT	WINDOW	WOOD	FAIR	BEIGE	BLDG 2417	THIRD	STAIR	STOOL	Negative	0.3	0
211	**PAINT**	**STRINGER**	**CONCRETE**	**FAIR**	**TAN**	**BLDG 2417**	**THIRD**	**STAIR**		**Positive**	**0.3**	**0.4**
212	**PAINT**		**CALIBRATE**							**Positive**	**0.3**	**1**
213	**PAINT**		**CALIBRATE**							**Positive**	**0.3**	**0.3**
214	**PAINT**		**CALIBRATE**							**Positive**	**0.3**	**0.3**
215	SHUTTER_CAL											10.9
216	**PAINT**		**CALIBRATE**							**Positive**	**0.3**	**0.9**
217	**PAINT**		**CALIBRATE**							**Positive**	**0.3**	**0.3**
218	**PAINT**		**CALIBRATE**							**Positive**	**0.3**	**0.4**
219	PAINT	WALL	DRYWALL	FAIR	BEIGE	BLDG 2917	FIRST-HMRHD	152		Negative	0.3	0
220	PAINT	WALL	DRYWALL	FAIR	PINK	BLDG 2917	FIRST-HMRHD	152		Negative	0.3	0.05
221	PAINT	DOOR	METAL	FAIR	PINK	BLDG 2917	FIRST-HMRHD	150	CASING	Negative	0.3	0
222	PAINT	WINDOW	WOOD	FAIR	WHITE	BLDG 2917	FIRST-HMRHD	150	STOOL	Negative	0.3	0
223	PAINT	WALL	DRYWALL	FAIR	BEIGE	BLDG 2917	FIRST-HMRHD	149		Negative	0.3	0
224	PAINT	WINDOW	WOOD	FAIR	WHITE	BLDG 2917	FIRST-HMRHD	149	STOOL	Negative	0.3	0
225	PAINT	WALL	DRYWALL	FAIR	TAN	BLDG 2917	FIRST-HMRHD	SHOWER		Negative	0.3	0
226	PAINT	CEILING	DRYWALL	FAIR	TAN	BLDG 2917	FIRST-HMRHD	HALL		Negative	0.3	0
227	PAINT	DOOR	METAL	FAIR	PINK	BLDG 2917	FIRST-HMRHD	140		Negative	0.3	0
228	PAINT	WALL	CONCRETE	FAIR	TAN	BLDG 2917	FIRST-HMRHD	140		Negative	0.3	0
229	PAINT	DUCT	METAL	FAIR	TAN	BLDG 2917	FIRST-HMRHD	140		Negative	0.3	0.02
230	PAINT	CEILING	CONCRETE	FAIR	WHITE	BLDG 2917	FIRST-HMRHD	140		Negative	0.3	0.06
231	PAINT	CEILING	CONCRETE	FAIR	WHITE	BLDG 2917	FIRST-HMRHD	140		Negative	0.3	0.01
232	PAINT	DOOR	METAL	FAIR	PINK	BLDG 2917	FIRST-HMRHD	144		Negative	0.3	0
233	**PAINT**		**CALIBRATE**							**Positive**	**0.3**	**0.9**
234	**PAINT**		**CALIBRATE**							**Positive**	**0.3**	**0.29**
235	**PAINT**		**CALIBRATE**							**Positive**	**0.3**	**0.29**