

Request For Information

Submitted By: Aaron Chamberlain

Title: CSII

Region: III

Institution: CIM

Project Name: Replace Roofs (Program Phase 1 - 4)

Title: Roof Replacement - Phase 1 Facility B

RFI#: 006

Date: 9/8/2025

Needed By: 9/15/2025

CCM Proj. # I-001123

A/E Proj. # 22-090



RFI Description – Correctional Construction Mentorship Program (CCM)

1. Plan Set 22-090 Plan sheet A3.9 Special Condition 1 and 4 shows to remove and replace existing windows. CCM Field wants to verify that glazing is to be replaced not windows. See attached drawings.
 2. CCM also wants to verify Detail 1 A3.9 will be used for Special Condition 1 and 4 per plan?
- Please Advise?

Location: Plan Set 22-090, FAC B UNIT 2

Attachments

Plan(s) Sht/Detail: 22-090 Pg.A3.9-1- Special Condition 1 and 4

Product Data: N/A

Specification: N/A

Memo / Letter: N/A

Submittals: N/A

Images: N/A

Shop Drawings: Field provided slopes of existing condition to roof

Other: N/A

drains

Response To RFI – Architecture and Engineering Section

A CB will be issued once the consultant provides the corrected drawings.

Attachments

Plan(s) Sht/Detail: N/A

Product Data: N/A

Specification: N/A

Memo / Letter: N/A

Submittals: N/A

Images: N/A

Shop Drawings: N/A

Other: N/A


Response By: Eileen Tumlin, Senior Architect

Date: 10/3/2025

Access Compliance Review for Attachment: Not Required

SFM Approval for Attachment: Required

Timestamp of Response: [Final A/E

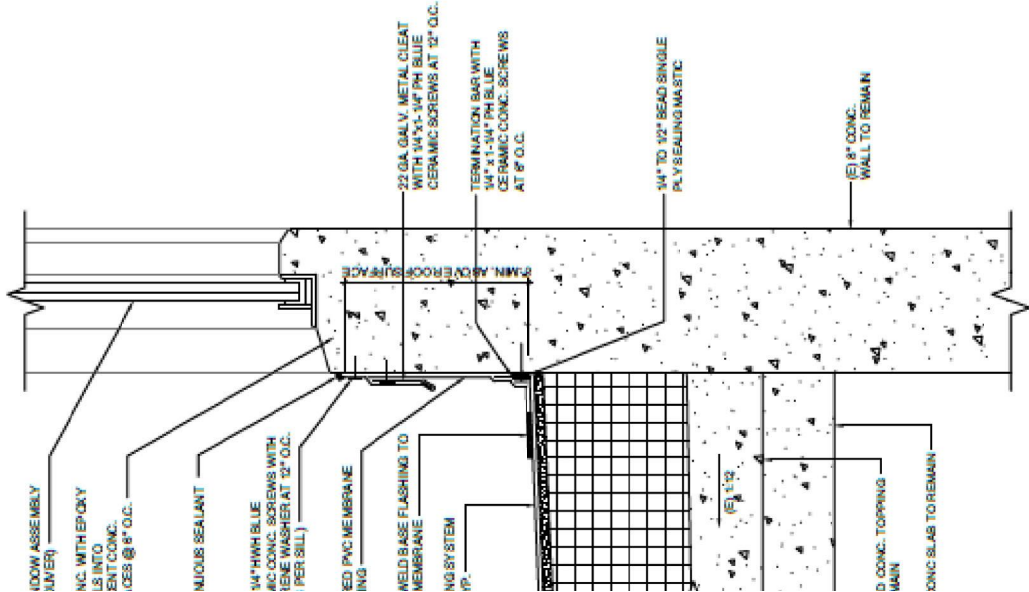

FIELD DETERMINE DIMENSIONS



- REMOVE AND REPLACE (E) STAIRS. SEE 98.133 FOR ADDITIONAL INFORMATION
- REMOVE LANTANCE, PEELING PAINT, ETC. AND PREPARE SURFACE TO BE RE-PAINTED. PAINT ENTIRE WALL THAT CONTAINS WINDOWS
- REMOVE (E) WINDOWS AND REPLACE. FIELD DETERMINE DIMENSIONS

2 SPECIAL CONDITION - 1

A3.9 SCALE N.T.S.



- REMOVE (E) EXPANSION JOINTS. REPAIR SUBSTRATE AND PREPARE FOR INSTALLATION OF NEW EXPANSIONS JOINTS

3 SPECIAL CONDITION - 2

A3.9 SCALE N.T.S.

REMOVE (E) EXPANSION JOINT, CURB, FLASHING, ETC.

REMOVE VERTICAL EXPANSION JOINT COVER. REPAIR CONCRETE WALLS AND PREPARE SURFACE TO RECEIVE (N) EXPANSION JOINT ASSEMBLY

REMOVE WINDOWS AND FLASHING AND PREPARE FOR NEW WINDOWS

REMOVE (E) EXPANSION JOINT, CURB, FLASHING, ETC.



22-090 CIM Replace Roofs Phase 1, Facility B, RFI 006 Notes on SFM-Approved Drawings

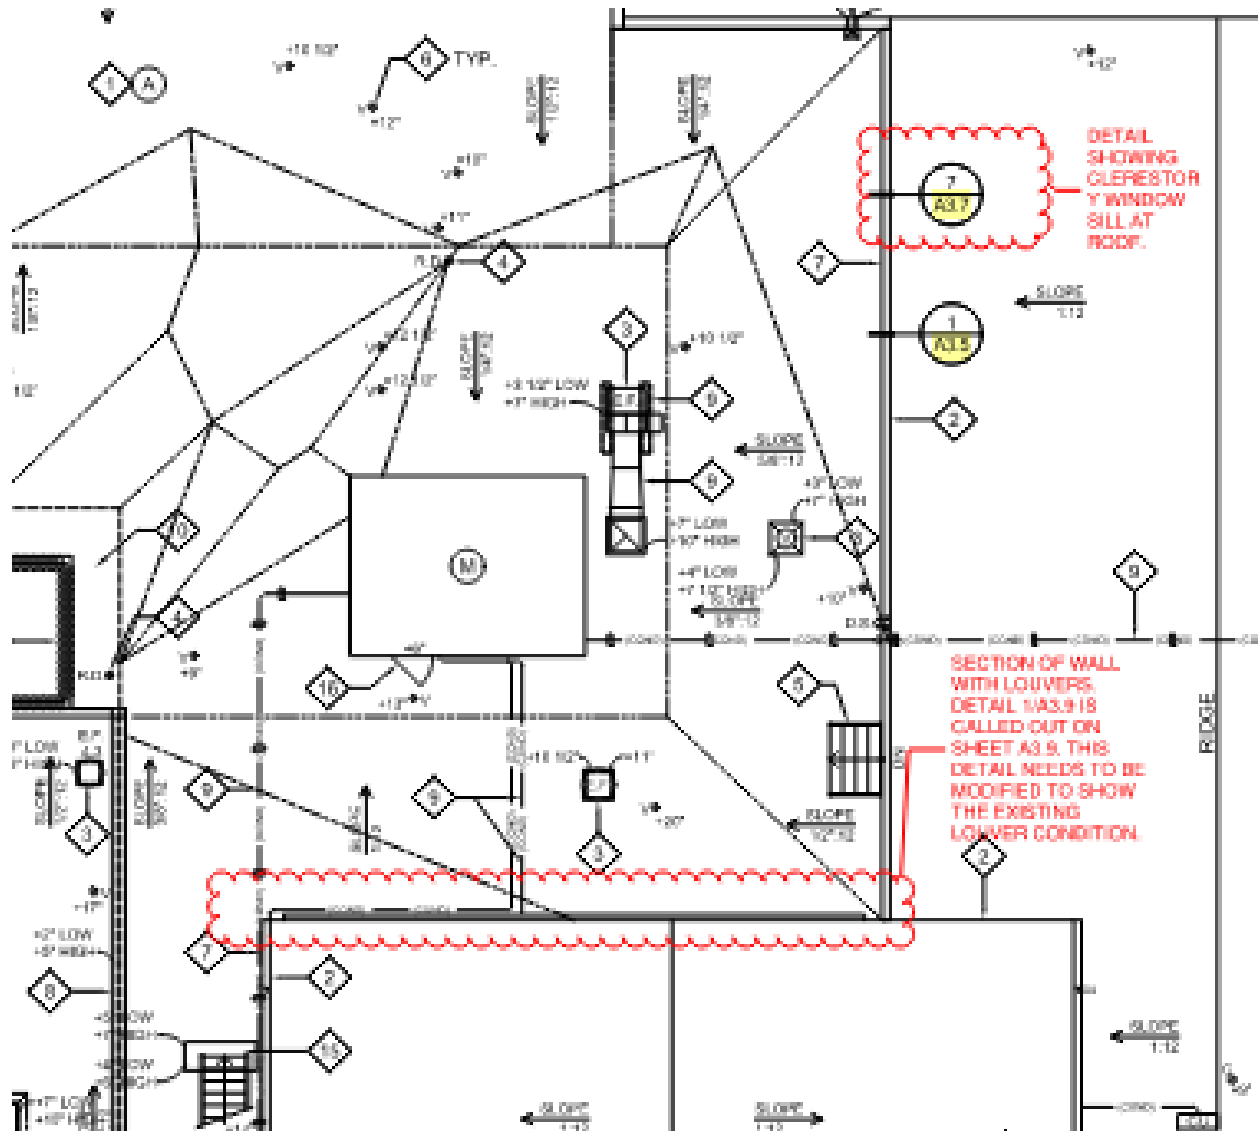


Figure 1: Snip from Sheet A1.5 showing demolition at Unit 2 roof. Detail 7/A3.7 is called out at existing clerestory window sill but there is no detail called out for the section of wall with the existing louvers.

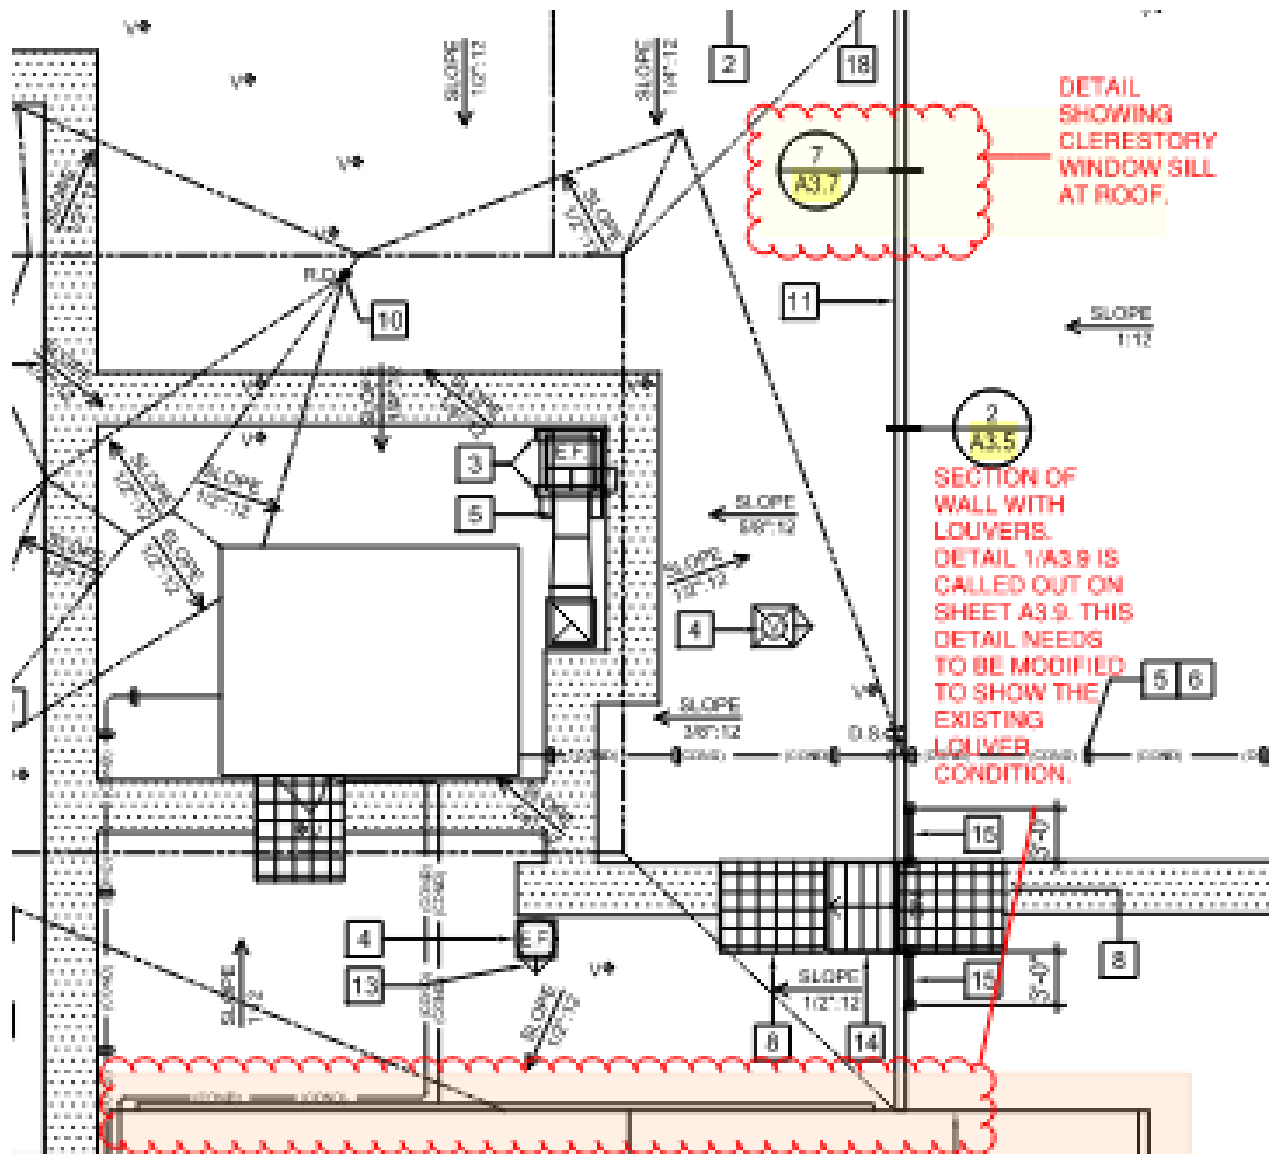


Figure 2: Snip from Sheet A2.5 showing new work at Unit 2 roof. Detail 7/A3.7 is called out at existing clerestory window sill but there is no detail called out for the section of wall with the existing louvers.

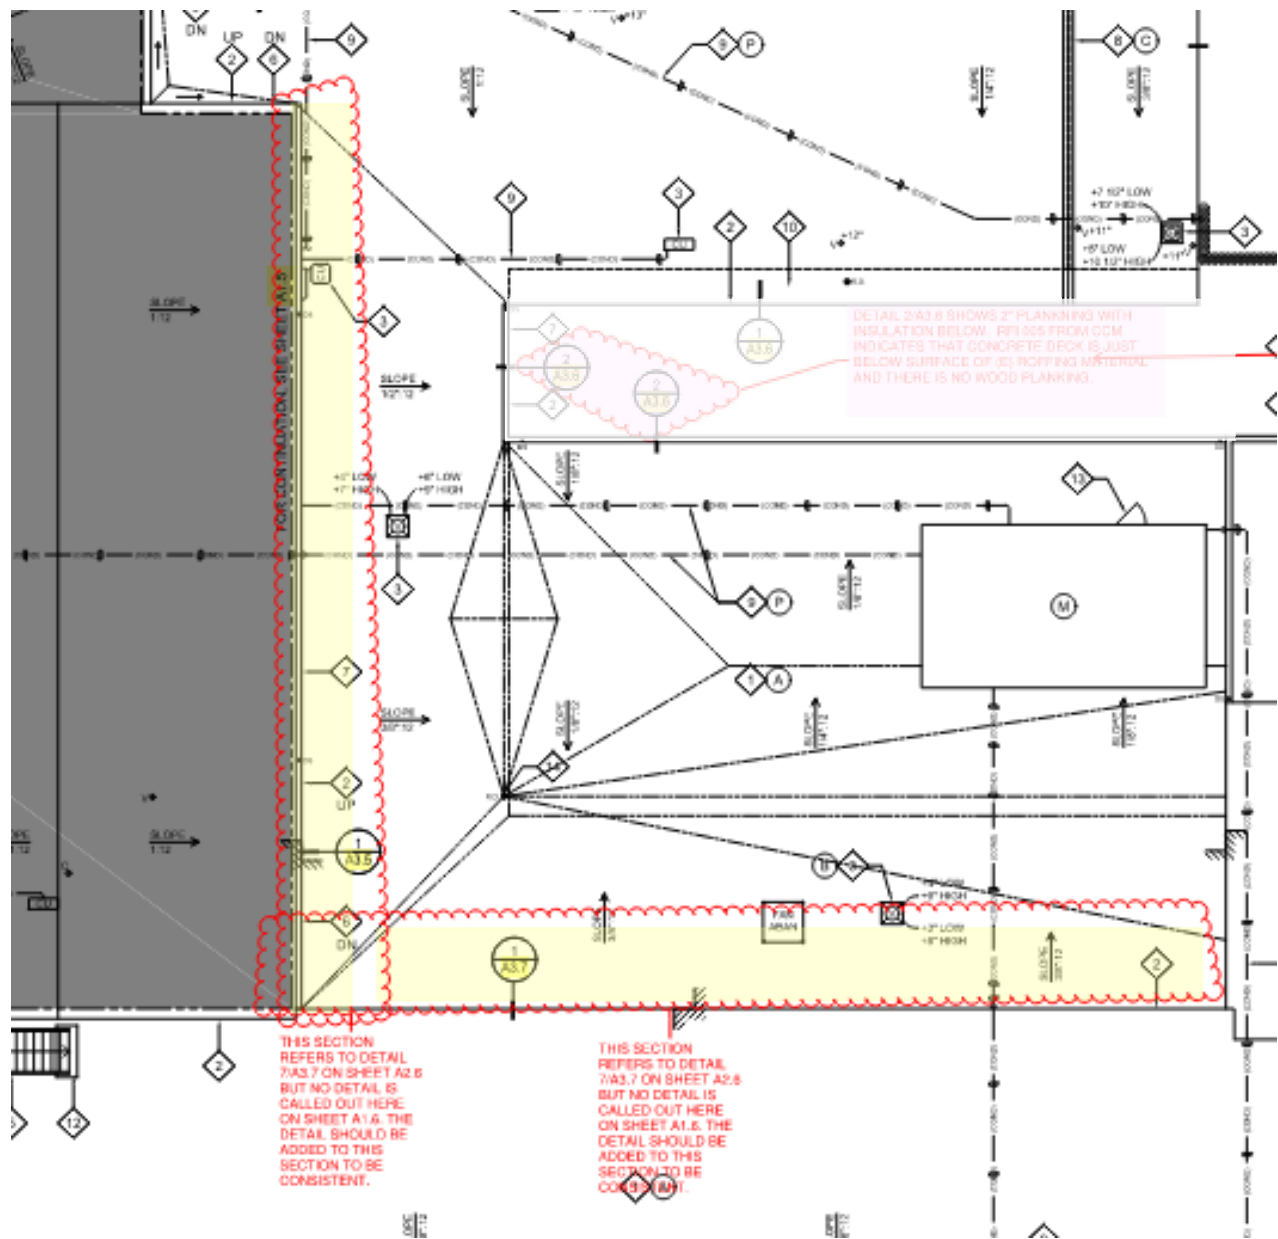


Figure 3: Snip from Sheet A1.6 showing demolition at Unit 2 roof. Detail 7/A3.7 is not called out at existing clerestory window sill and there is no detail called out for the section of wall with the existing louvers. Details at these conditions should be added.

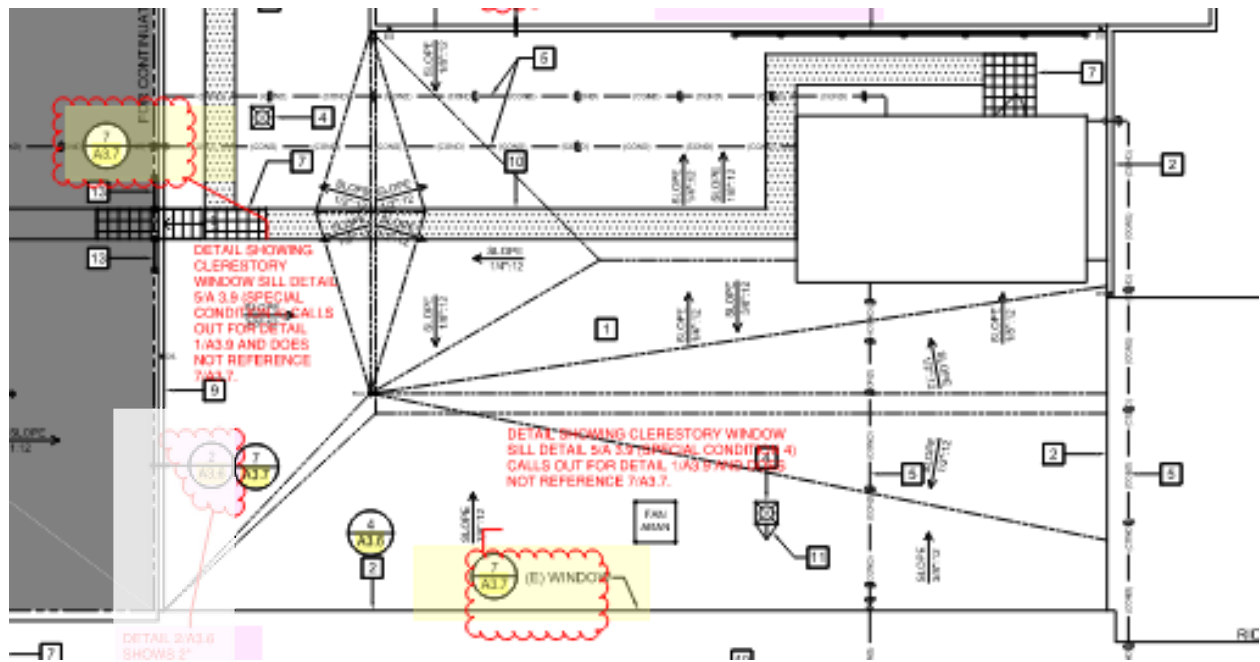


Figure 4: Snip from Sheet A2.6 showing demolition at Unit 2 roof. Detail 7/A3.7 is called out at existing clerestory window sill and at the section of wall with the existing louvers. Details at these conditions should be added/corrected. Detail 1/3.9 is referred to at this location on Sheet A3.9 but does it apply here? The details need to be corrected.

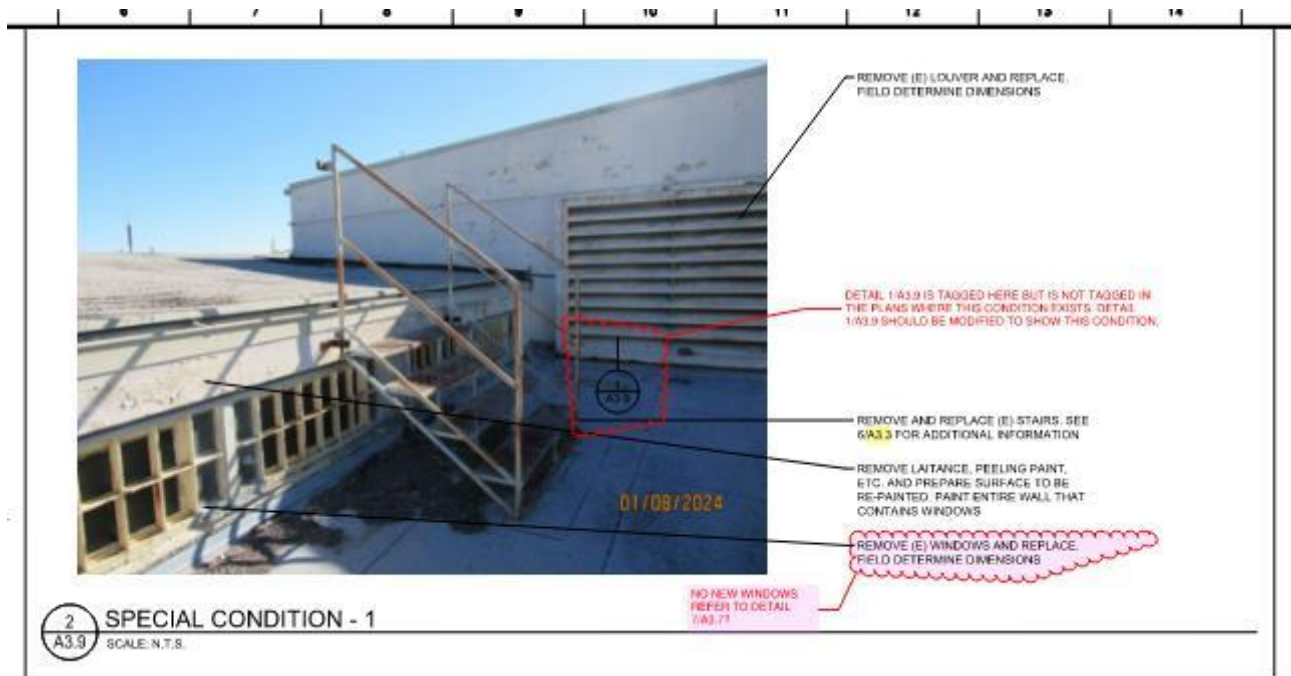


Figure 4: Snip from Sheet A3.9 showing detail 1/A3.9 tagged at louver wall. Detail 1/A3.9 needs to be modified to show louver condition. Does Detail 7/A3.7 should be tagged at clerestory window and any reference to removing and replacing windows should be removed. Glazing may need to be removed and replaced with steel plate per Detail 7/A3.7 but windows are not being replaced.

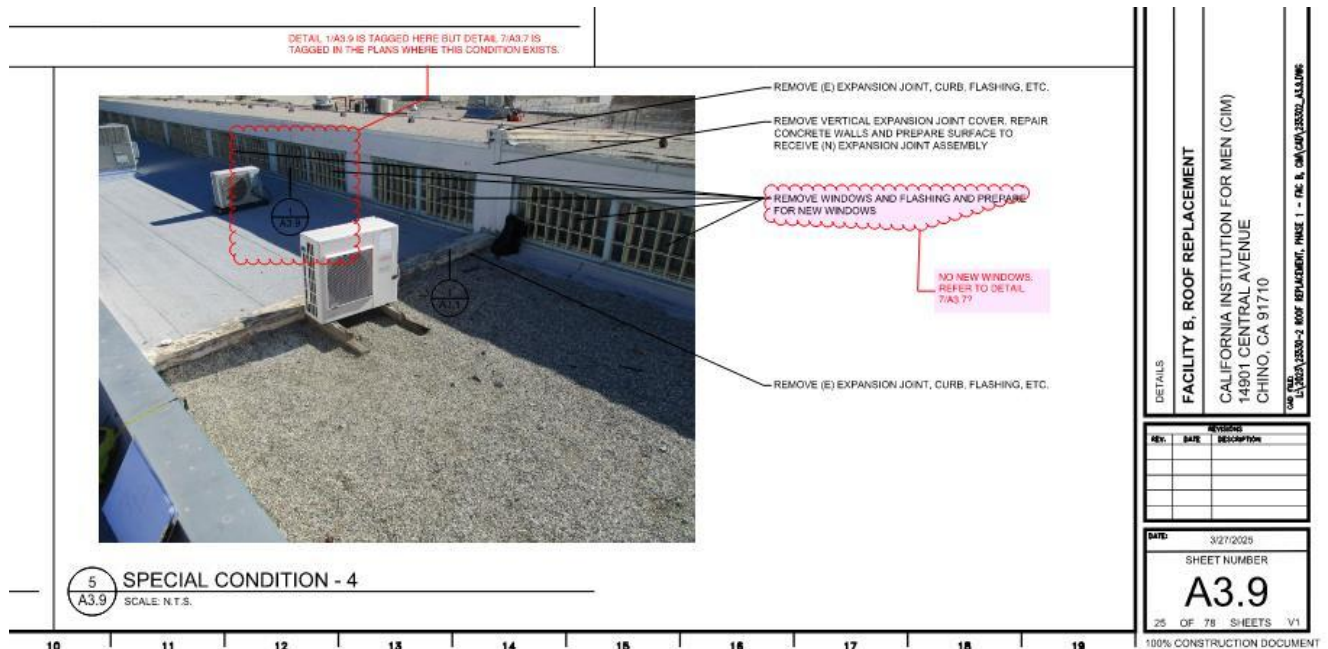


Figure 5: Snip from Sheet A3.9 showing detail 1/A3.9 tagged at louver wall. Detail 1/A3.9 needs to be modified to show louver condition. Does Detail 7/A3.7 should be tagged at clerestory window and any reference to removing and replacing windows should be removed. Glazing may need to be removed and replaced with steel plate per Detail 7/A3.7 but windows are not being replaced.

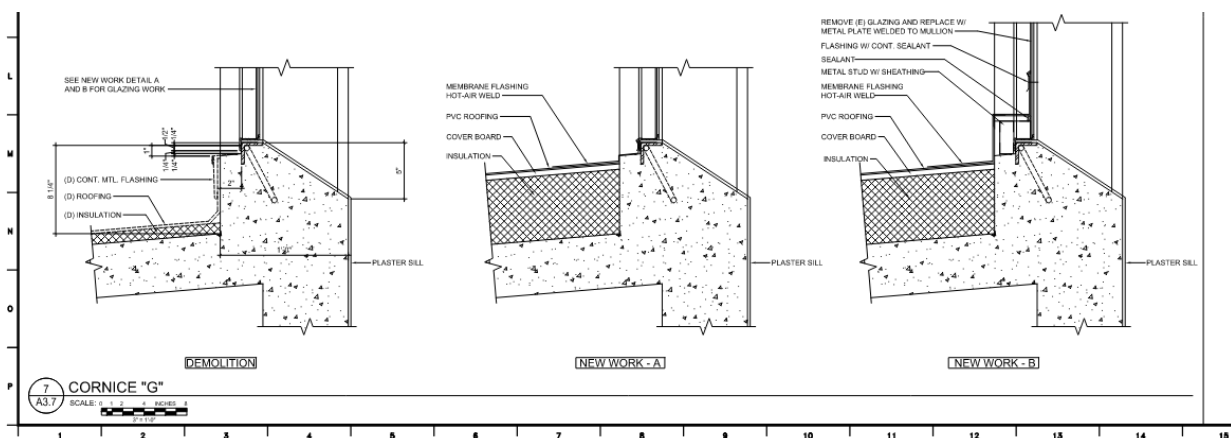


Figure 6: Snip from Sheet A3.7 showing Detail 7/A3.7. This is not a “Cornice” detail, it is a clerestory window sill detail and that should be corrected. This detail needs to be tagged in all locations where it applies.

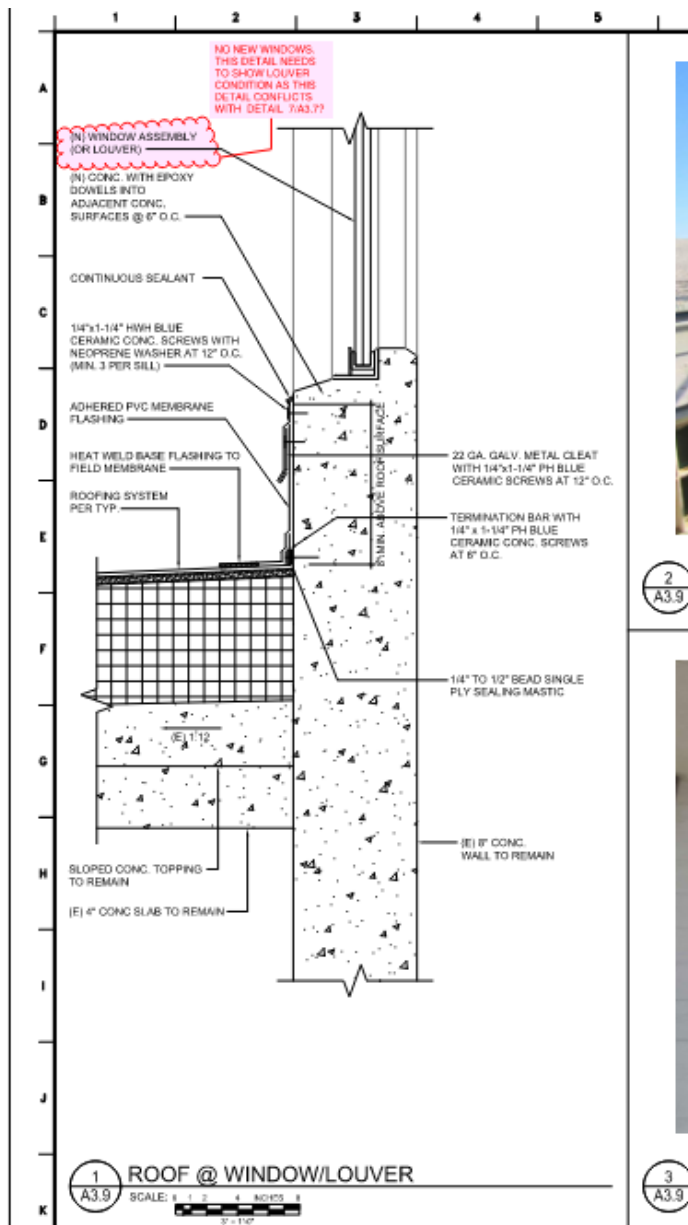


Figure 7: Snip from Sheet A3.9 showing Detail 1/A3.9. There are no new windows so references to this should be removed everywhere. This detail either conflicts with Detail 7/A3.7 or is redundant. There is no detail properly showing how existing louvers will be dealt with at new roof assembly. This detail should be corrected and tagged appropriately to represent the actual conditions and proposed new work.

